


Use Right Mount, Reinforced

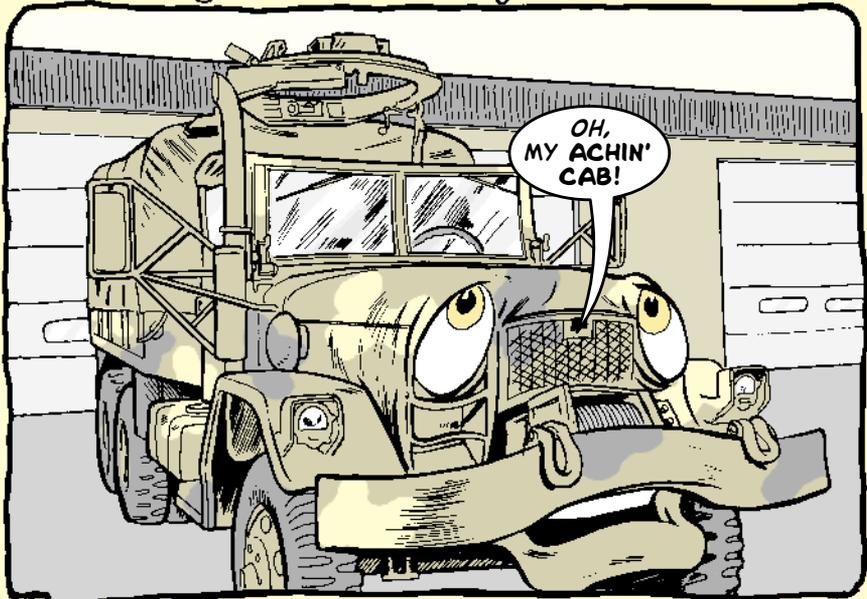


Now is a good time to eyeball the cabs on your older M44-series 2½-ton and M809-series and M939-series 5-ton trucks that have machine gun ring mounts.

Many of these older trucks still use the obsolete M36 ring mounts that have no reinforcement against vibration. The vibration can cause cab cracks that make your vehicle NMC.

If you find no damage, continue to use the old ring mount.

If you find damage on an M939-series 5-ton, get with your support to fix the damage and install the M66 ring mount, NSN 1005-00-701-2810, with mounting kit, NSN 1005-01-432-3339, and cab reinforcement kit, NSN 2590-01-436-9144.

Mount need replacing? Install M66 mount

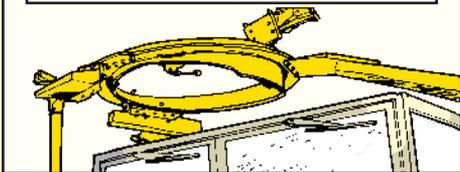

For the M44-series 2½-ton and M809-series 5-ton trucks, your support will need mounting kit, NSN 1005-01-226-4589, and cab reinforcement kit, NSN 2590-01-322-2694, in addition to the M66 ring mount.

Mounting instructions come with the kits. Once the M66 is installed, unit maintenance can replace most parts of the reinforcement kit. The parts breakdowns are found in the parts manuals for the trucks.