


Check for MWO


MWO 11-6665-251-40-1 added an electronic chip to the AN/VDR-2 radiac set that made it easier to set the attenuation factors and store accumulated dose readings.

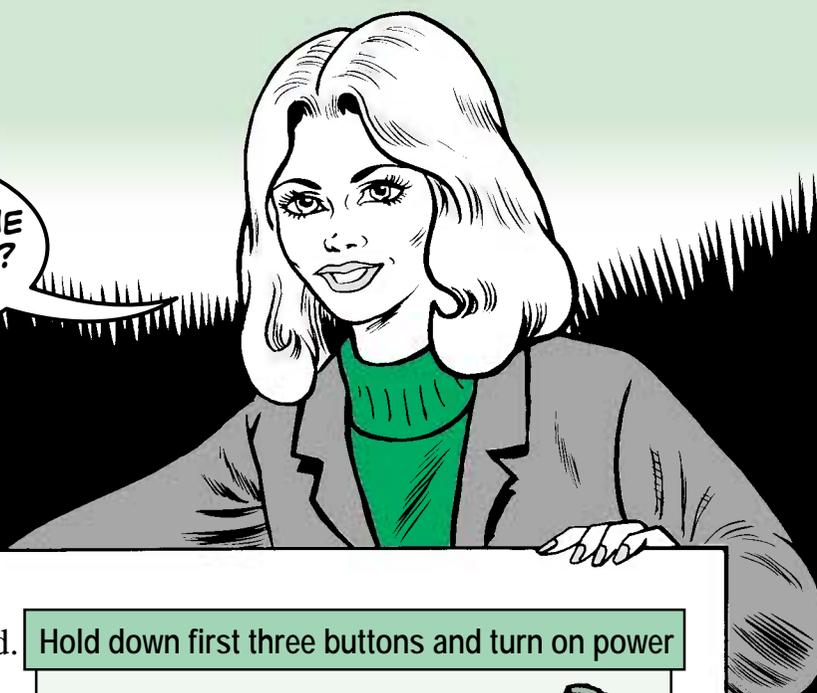

UNSURE IF THE
MWO HAS BEEN DONE
TO YOUR AN/VDR-2?
HERE'S HOW TO
TELL!

1. Make sure batteries are installed.
2. With power off, simultaneously hold down the CLR/TST, DOSE PER HR, and ACCUM DOSE buttons.
3. Turn on the power with the buttons still held down. All LEDs should illuminate.
4. Release the three buttons and press CLR/TST. You should see 01.
5. Press CLR/TST again. You should see 31.
6. Press CLR/TST again. You should see 94.

Hold down first three buttons and turn on power

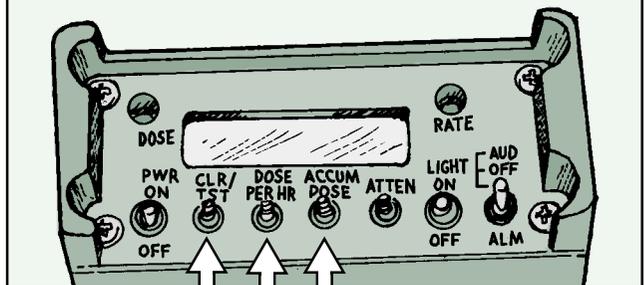

A date other than 01 31 94 indicates the MWO hasn't been done. Your TMDE will have to perform the MWO and calibrate the radiac set.

