



STOCK UP ON
THESE WHEELED
VEHICLE "SHORTS"

M939A2 Steering Line

NSN 2530-01-470-9033 gets the M939A2-series power steering line shown as Item 1 in Fig 313 of TM 9-2320-272-24P-1. NSN 4710-01-471-5060 gets Item 7 of the same figure. The NSNs shown for Items 1 and 7 are for M939/A1-series trucks.

HEMTT Oil Filter Gasket

NSN 5330-01-466-1532 gets the gasket for the hydraulic oil filters on M977, M984A1 and M985 HEMTT cranes. The NSN shown for Item 16 in Fig 412 of TM 9-2320-279-24P-2 is wrong.

Fan Solenoid for M919

Use NSN 4810-01-414-3138 to get the fan solenoid for the M919 concrete-mobile mixer truck. It replaces Item 13 in Fig 30 of TM 9-2320-273-24P, which is no longer available. Make a note until the TM is updated.

M939/A1 Spring

Use NSN 5360-01-470-6574 for the helical spring for your M939/A1-series truck. The NSN shown as Item 17 in Fig 183 of TM 9-2320-272-24P-1 is wrong.

FMTV Brake Spider

NSN 2530-01-467-4098 gets the replacement brake spider for FMTV trucks. The spider shown as Item 9 in Fig 133 of TM 9-2320-365-24P for 2 1/2-ton FMTVs, and as Item 9 in Fig 161 of TM 9-2320-366-24P-1 for 5-ton models, is obsolete. Make a note 'til the TMs are updated.

M915A1 Switch

NSN 6685-01-081-9721 gets the thermostatic switch for the tractor truck's engine. The NSN shown as Item 3 in Fig 42 of TM 9-2320-283-24P is no longer available.

M35A3 Wheel Assembly

NSN 2530-01-398-2022 gets the tire beadlock that's shown as Item 2 in Fig 117 of TM 9-2320-386-24P. Order the grommet (Item 11) and plain nut (Item 12) with NSN 5325-01-437-5810 and NSN 5310-01-445-6872. The TM parts info is wrong. Make a note until the TM is updated.

M35A3 Alternator Brackets

You need two brackets to hold the M35A3's alternator in place, but you don't get NSNs in TM 9-2320-386-24P. Make a note in Fig 51 until your TM is updated:

Item 3, upper bracket--NSN 5340-01-397- 3421
Item 12, lower bracket--NSN 5342-01-444- 9149

M35A3 Fitting

NSN 4730-01-391-8317 gets a T-fitting for the air line on the M35A3's rear wheels. The parts info shown for Item 9 in Fig 171 of TM 9-2320-386-24P is wrong.

HMMWV Spring Ring

NSN 5325-01-135-4290 gets the retaining ring that secures the gas springs on the HMMWV's rear cargo-shell door. The NSN is missing from Item 35 in Fig 235 of TM 9-2320-280-24P-1.


HMMWV Ax Bracket

If the pioneer ax and its sheath won't fit in the bracket on your M1114 up-armored HMMWV's tailgate, get a bigger bracket. It's free when you call TACOM at DSN 786-6212/8398 or (810) 574-6212/ 8398. You can also e-mail: yasonia@tacom.army.mil or marar@tacom.army.mil

PLS Lift Pin

NSN 5315-01-411-2482 gets the PLS tractor truck's lift pin shown as Item 9 on Page B-5 of TM 9-2320-364-10. NSN 5315-01-419-8204 gets the lift pin shown as Item 10 on the same page. Make a note until these NSNs are updated in the TM.

KEEP
'EM
ROLLIN'!

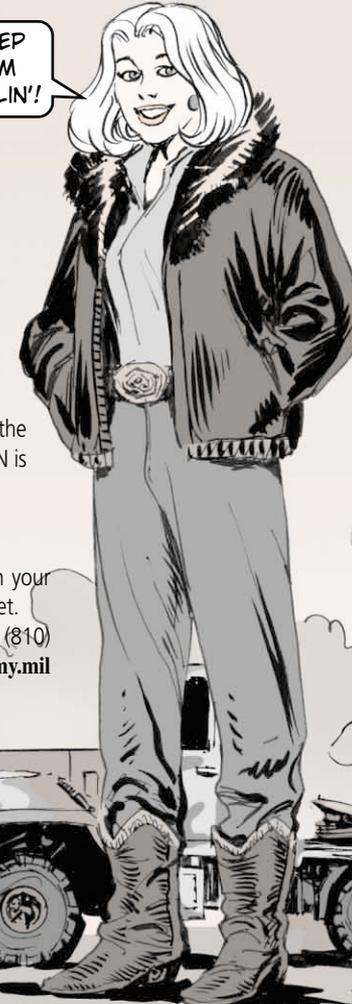

PS 582

12

MAY 01



PS 582