



A Goodly Amount of Mount Info

PS NOW BRINGS YOU THE **LATEST** ON MACHINE GUN MOUNTS. AND WITH NO COMMERCIAL INTERRUPTIONS.

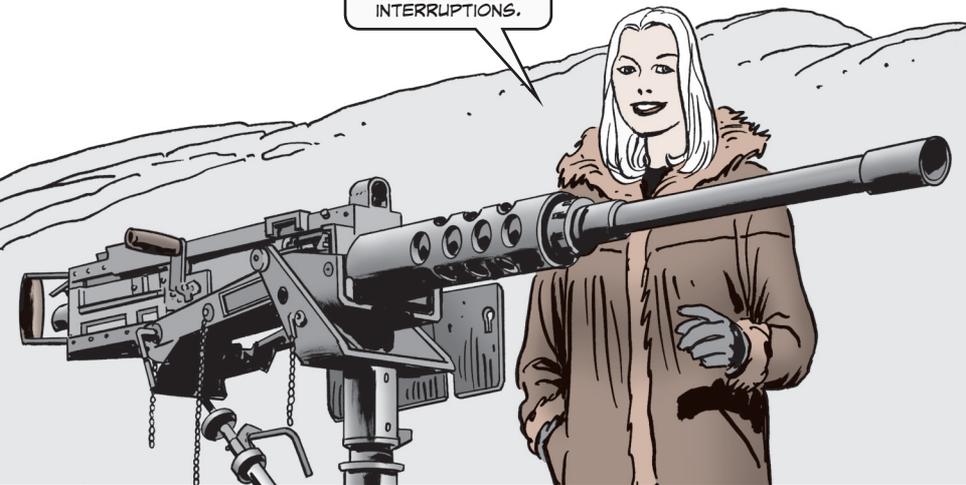

New and improved machine gun pedestal—The new M7 HMMWV pedestal, NSN 1005-01-518-9037, is an improvement over the old M6. It can be mounted in the forward or rear (over the wheel wells) positions on the M998 cargo carrier. The M7 comes with a larger mounting plate to stop spent casings building up along the edges of the vehicle bed. Its column base has been redesigned to eliminate cracked support braces and tripping hazards. And it has a depression stop to prevent accidental firing in the cab area. The stop, NSN 1005-01-519-2129, can also be used with the M6 and can be ordered as an M6 additional authorized item.

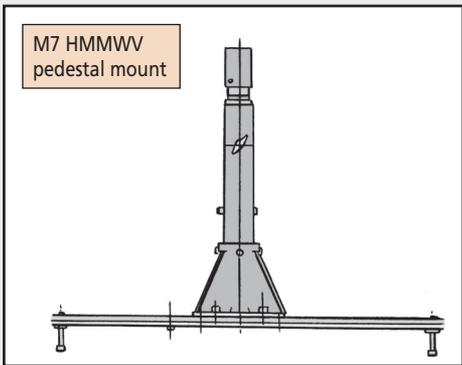


M7 HMMWV pedestal mount

MK93 MOD 1 and MOD 2 and MK64 MOD 9 catch bag assemblies—These catch bags can be ordered by component now:

MK64 MOD 9


- Catch bag (olive), NSN 1005-01-388-5702
- Catch bag (sand), NSN 1005-01-388-5685
- Catch bag frame, NSN 1005-01-516-3961

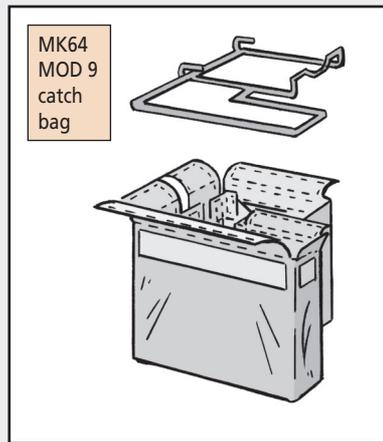

MK64 MOD 9 catch bag

MK93 MOD 1 and MOD 2

- Catch bag (olive), NSN 1005-01-388-5702
- Catch bag (sand), NSN 1005-01-388-5685
- Catch bag frame, NSN 1005-01-513-9741
- Quick release pin, NSN 5315-01-385-9216

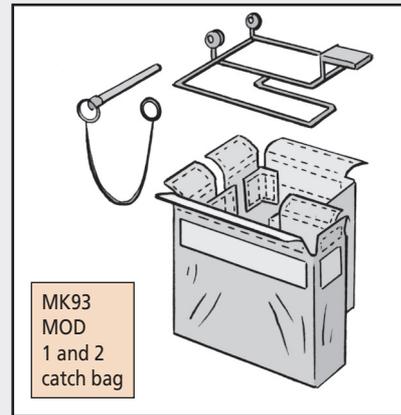


MK93 MOD 1 and 2 catch bag




HERE'S SOME **IMPORTANT** INFO TO HAVE ON THE **MK93 MOD 1 AND MK93 MOD 2!**

MK93 MOD 2 replaces MK93 MOD 1—The MOD 2, NSN 1010-01-502-7547, is virtually identical to the MOD 1, except it's cheaper. When you need a new MK93, order the MOD 2.

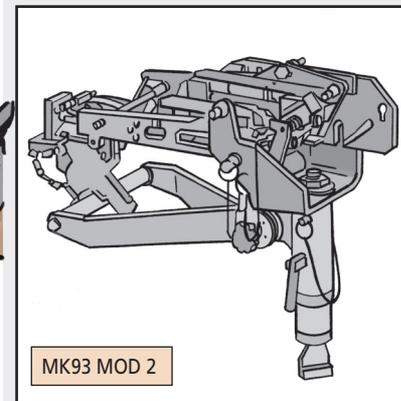

MK93 MOD 2

New mount TM—TM 9-1005-245-13&P has been updated and can now be ordered through your pubs account. But don't throw out your old copy. The new -13&P doesn't contain info on the M66 ring mount because a separate pub, TM 9-1005-335-13&P, is being written for the M66. Until it comes out, you'll need to consult the older version of TM 9-1005-245-13&P for M66 info. PS will let you know when you can order TM 9-1005-335-13&P.

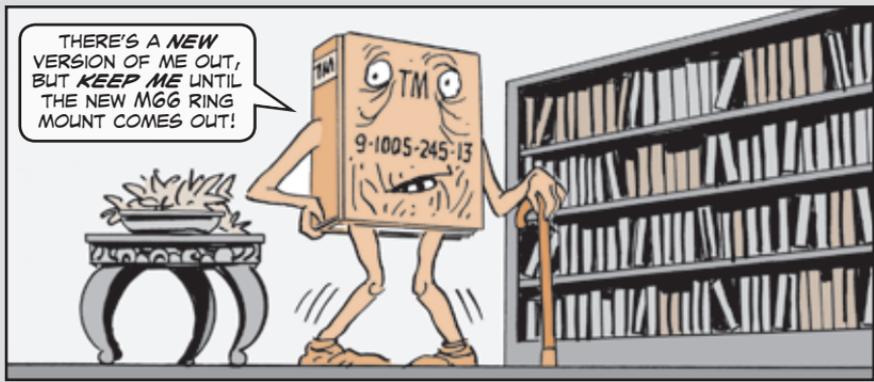

IF YOU HAVE QUESTIONS ABOUT THE M7 PEDESTAL, CONTACT TACOM'S CRAIG NELSON AT DSN 793-3459/(309) 782-3459 OR EMAIL: nelsonc@ria.army.mil

IF YOU HAVE **OTHER** MOUNT QUESTIONS, CONTACT TACOM'S BARB PAINTER AT DSN 793-4403/(309) 782-4403 OR EMAIL: barb.painter@us.army.mil



Inspection Changes for M230 Roller Chain

Change 13 to TM 9-1090-208-23-1-1 said the M230 automatic gun's roller chain assembly didn't need to be replaced until 15,000 rounds, instead of the previous limit of 10,000. But TACOM has decided that's wrong and the assembly may break before 15,000 rounds. So the limit is again 10,000 rounds. Make the change on Page 4-46.1. The limit for the firing pin assembly remains 15,000. See TACOM maintenance advisory message 05-041 for more details.