

END OF SHOCK WASHER WOES

WE GOT IN ANOTHER NEW SHIPMENT OF SHOCK ABSORBER WASHERS.

LET ME GUESS... THEY'RE TOO SMALL!


Dear Half-Mast,

We're having a washer issue here in Iraq. Whenever we order the outer washer, NSN 5310-00-928-1885, for the shock absorbers on our M2A2 Bradleys, we get one that's much too small for the job.

I'm not sure if we're being sent the wrong washer or if the NSN in the TM is wrong. Can you check this out for us?

MSG L.R.L.

Outer washer received from supply is much smaller...

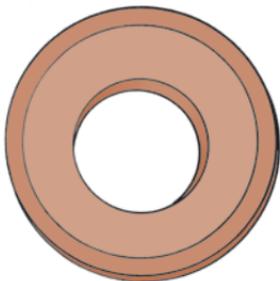

...than washer you *should* be getting

Dear MSG L.R.L.,

You bet! It turns out that there are problems with the NSNs for both the inner and outer washers. Until all the TMs are corrected, get out your stubby pencils and make the following corrections:

- **TM 9-2350-294-24P-1 (M2A3/M3A3), Fig 54:** Item 20 (inner washer) should be NSN 5310-01-413-1037, PN 10910174-25, and Item 21 (outer washer) should be NSN 5310-01-104-9035, PN 10910174-38.
- **TM 9-2350-284-24P-1 (M2A2/M3A2, M2A2 ODS/M3A2 ODS), Fig 82:** Item 20 (inner washer) should be NSN 5310-01-413-1037, PN 10910174-25, and Item 21 (outer washer) should be NSN 5310-01-104-9035, PN 10910174-38.
- **TM 9-2350-252-24P-1 (M2/M3, M2A1/M3A1), Fig 66:** Item 19 (inner washer) should be NSN 5310-01-413-1037, PN 10910174-25. The correct information for Item 20 (outer washer) is already listed.
- **TM 9-1450-646-24P (M993 MLRS), Fig 9:** Item 15 (inner washer) should be NSN 5310-01-413-1037, PN 10910174-25. The correct information for Item 16 (outer washer) is already listed.

Half-Mast