

# CROSS-COUNTRY CAN CRACK COVERS



A good example is the rear periscope cover screws. Enough vibration can loosen the screws. Eventually, that can lead to a broken cover. Replacement covers range from \$60 to nearly \$100 a pop, so you don't want to replace them too often.

Check the screws during your PMCS inspection. If they're loose, tighten 'em. Replace missing screws with NSN 5305-00-068-0511 and missing flat washers with NSN 5310-00-080-6004.

And if you do find a broken cover, make sure you order the right replacement. There are six periscopes on the back of the Bradley and four different covers. You'll find them listed as Items 2, 14, 18, and 19 in Fig 34 of TM 9-2350-294-24P-1.

