
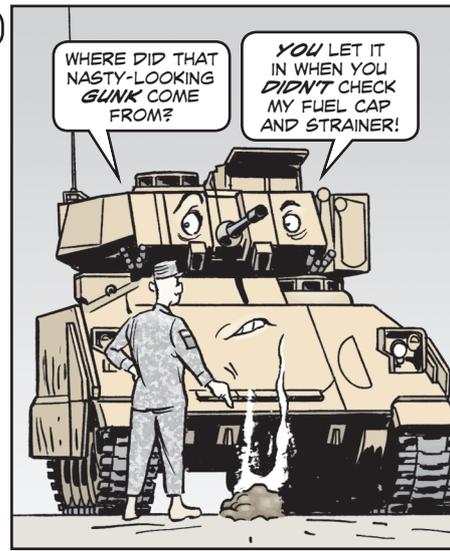
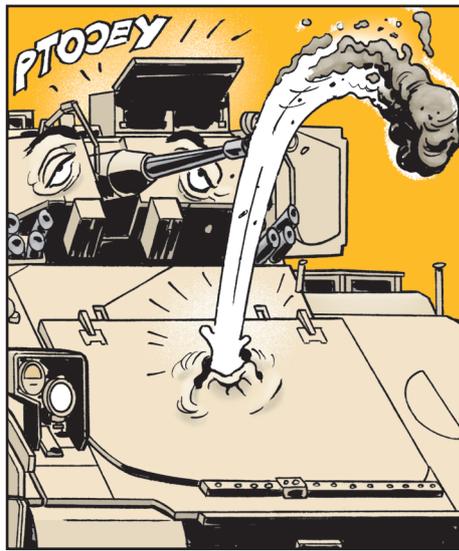


# KEEP THE GUNK OUT!

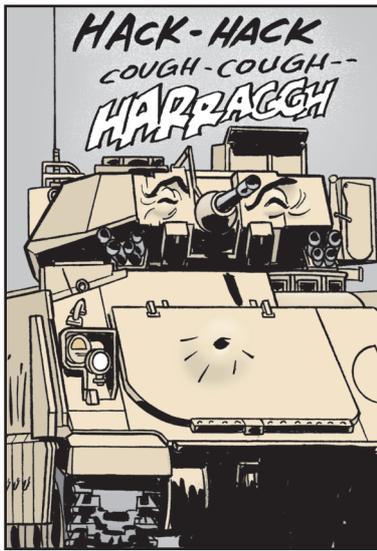

**W**ater, sand and dirt combined with fuel make a toxic mixture for your Bradley's engine, crewmen. And the first line of defense is the vehicle's fuel cap, gasket and strainer.


Dirt and sand collect around the filler neck. If you don't keep it clean, that buildup can make it hard to close the cap properly. Forcing the cap tears the fuel gasket. That allows rain water to trickle down into the fuel system along with the dirt and sand.

You'll know there's a problem when engine performance suffers. The condition can worsen until the fuel pump fails. If that happens, your Bradley will be out of action until the pump is replaced and the injectors are cleaned.

AFTER EVERY OPERATION, CHECK THE FUEL CAP, GASKET, AND STRAINER LIKE THIS...



1. Blow away any dirt that has collected around the filler neck before removing the fuel cap. If there's water there, soak it up with a clean rag.
2. Remove the fuel cap. Turn it upside down and look at the gasket. If it shows damage, get a new one with NSN 2590-01-482-1662.
3. Now look at the fuel gasket, NSN 5330-01-207-9163, in the filler neck. Any cuts, nicks or gouges mean the gasket needs to be replaced.
4. Pull out the fuel strainer and look for tears or holes. Replace a damaged strainer with NSN 4730-01-108-5253.

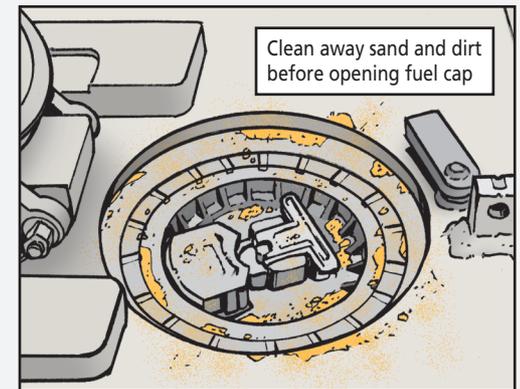

## M1064 Heater Kit Fitting NSN

Order a new pipe-to-tube elbow for the heater kit on your M1064 mortar carrier with NSN 4730-01-570-2492 (PN SAE J514 6-4 070203CZ, CAGE 81343). It replaces NSN 4730-00-289-2378, which is shown as Item 2 in Fig 327 of TM 9-2350-261-24P (Aug 05).

## M2A3/M3A3 Bradley BUSK Bench Seats

Need a new seatbelt screw for the IED bench seats on your M2A3/M3A3 Bradley urban survivability kit (BUSK)? PN B183A038C038HSHS, which is shown as Item 30 in WP 0058 00-11 and Item 24 in WP 0059 00-5 of TB 9-2350-395-13&P (Jun 08, w/Ch 1, Aug 08), doesn't cross to an NSN and is being replaced. Get the new screw with NSN 5305-01-566-3834 (PN 12517379, CAGE 19207). Make a note until the TB can be updated.