


# FIRE PREVENTION!

WOWEE!

SOME  
MECHANIC  
GAVE ME A  
HOTFOOT!

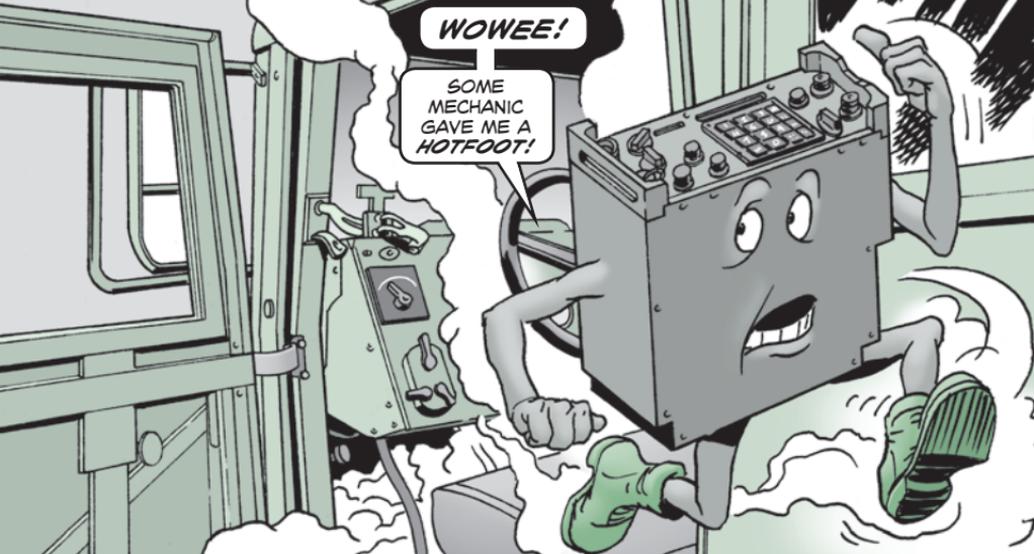


Dear Editor,

Please put the word out that a loose or incorrectly mounted E1 grounding wire inside the electrical connector assembly, NSN 5935-01-360-2630, of the MT-6352/VRC can burn out the EMI filter or the wiring.

So, when doing repairs of the electrical connector assembly, be sure that the E1 ground wire terminal lug is securely fastened to the EMI filter mounting screw. The screw is located near the end of the electrical connector. If the screw is missing, order a new one with NSN 5305-01-303-0311. And get a new washer with NSN 5310-01-540-5271.

David Yanosik  
RDECOM, CERDEC  
APG, MD

When repairing, check terminal lug!

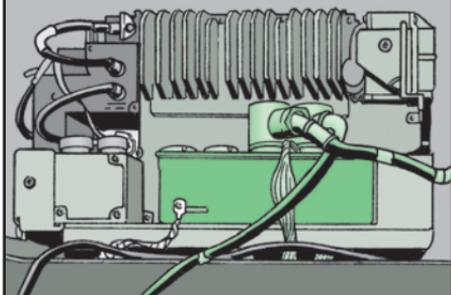

*Editor's note:* Thanks, David, for this important info. Maintainers, remember to do a continuity check to verify the ground when you replace or tighten the screw.