

Troubleshooting Codes 1701 and 1707

FOR THE GRAND PRIZE... ON HEMTT -A4 TRUCKS, WHAT ARE FAULT CODES 1701 AND 1707?

UHH... I KNEW I SHOULD'VE READ THAT ARTICLE IN PS!

Name
That
Code

Dear Half-Mast,

Our unit can't find repair tracks for fault codes 1701 and 1707 in the HEMTT -A4 IETM's troubleshooting section. Can you help us out with these codes?

SSG J.C.L.

Dear Sergeant J.C.L.,

Can do. TACOM LCMC tells us that both of these fault codes—1701 and 1707—will be added to the HEMTT -A4 IETM in the next change. In the meantime, here's what you need to know:

Code 1701 is the result of a programming issue. It appears when the software attempts to check a component that is not part of the HEMTT -A4's configuration.

If you get this code, contact your local logistics assistance representative (LAR). Your LAR has access to commercial software and instructions that can help resolve this fault.

As for the second fault code in question—1707—here's the deal: Operators must depress the brake pedal **every** time they start a HEMTT -A4 series truck. If they don't, the ABS light may illuminate and the flash code 1707 appears.

Try to clear this fault code with a firm, swift push on the brake pedal. If that doesn't work, shut down your vehicle, hold the brake pedal down and restart your -A4 truck. Get field maintenance to assist you if that doesn't solve the problem.

Half-Mast