



350 GPM Pump Starter NSN

Get a new starter for the John Deere engine on your 350 GPM fuel and water pumps with NSN 2920-01-605-5572. Make a note until the NSN can be added to TMs 10-4320-372-24P (fuel pump) and 10-4320-226-24P (water pump).

FRS DOOR SEAL NSN

Get a new door seal for the forward repair system (FRS) with NSN 5330-01-606-6525. This NSN replaces PN RIA152104, which is shown as Item 14 in Fig 148 of TM 9-4940-568-24P (Jan 08, w/Ch 1, Jul 11). By the way, you'll need to order two seals and cut them to length for one door. It takes four seals, cut to length, to handle both doors.

M871A3 Semitrailer Clearance Light

The NSN for your M871A3 semitrailer's clearance light, shown as Item 2 of Fig 2 in TM 9-2330-326-14&P (Feb 06), is a little misleading. Only the light—without the base—comes with NSN 6220-01-499-3374. Get the light *and* base with NSN 6220-01-595-4730 (PN 4337A). You should see this correction in a future TM update.

ATLAS/6K FORKLIFT SERVICE KITS

Need a service kit for your 10K ATLAS or 6K forklift? Order what you need from these NSNs:

Forklift	250-hr Kit NSN 2990-	500-hr Kit NSN 2990-	1,000-hr Kit NSN 2990-
ATLAS I		01-586-9819	01-586-9815
ATLAS II	01-600-4318		01-600-4317
6K		01-585-9284	01-585-8958

SPARK II Debris Shield

A new debris shield is now available for the self protection adaptive roller kit II (SPARK II) that mounts to the front of your M-ATV MRAP. The shield is designed to keep dirt and debris from clogging the M-ATV's radiator and overheating the vehicle's engine. Order the debris shield with NSN 2540-01-596-0710, then go to this link for a list of the shield's parts and installation instructions: https://tulsa.tacom.army.mil/safety/gpm/tacom_wn/InterfaceBracketDebrisShieldIntegrated.docx

FDECU MAY HAVE CONTAMINATED REFRIGERANT

Units that have field deployable environmental control units (FDECU), models 2, 3, 4, 5 and 9, NSN 4120-01-449-0459, pay close attention. Your FDECU could have a refrigerant contaminated with methyl chloride, also known as R-40. Methyl chloride is flammable and explosive when exposed to the atmosphere or aluminum. It could damage the FDECU. What's worse, it could injure or kill you or others. For the complete story, get **CECOM Safety of Use Message (SOUM) 2012-001**. The message discusses root causes, hazards, inspection, reporting and more. You'll find the SOUM at the US Army CECOM Directorate for Safety website:

<https://cecomsafety.apg.army.mil/safety/safety%20messages/>

M1165A1 HMMWV Has Windshield Options

On Page 61 of PS 707 (Oct 11), we provided windshield NSNs for M1165A1 up-armored HMMWVs, but didn't tell you quite enough. HMMWVs have several windshield options and the NSNs we listed (2510-01-560-1159 and 2510-01-561-2540) bring the ballistic windshield with de-ice. When ordering parts, it's always a good idea to eyeball the FLIS characteristics in FED LOG to help ensure you get what you need.

Up-Armored HMMWV Windshield Washer Nozzle and Bracket

Need to replace the windshield washer nozzle on your M1151, M1151A1, M1152, M1152A1, M1165, M1165A1 and M1167 model HMMWVs? A new nozzle comes with NSN 2540-01-596-1571, but you'll need a new bracket to use it. Use bracket, NSN 5340-01-596-4595, with M1151A1, M1152A1, M1165A1 and M1167 HMMWVs with B kits and with M1151, M1152 and M1165 trucks. You may also use bracket, NSN 5340-01-596-4592, on M1151A1s, M1152A1s and M1165A1s with B kits. You won't find this in TM 9-2320-387-24P, so make a note until it's updated.

MW24C Scoop Loader Windshield

Use NSN 9340-00-599-6666 to get a windshield for the 2 1/2-yd scoop loader. The parts info shown as Item 14 in Fig 110 of TM 5-3805-262-24P gets the wrong-sized windshield.

M1112 Trailer Brake Line

The front hydraulic brake line for the M1112 water trailer comes with NSN 4710-01-436-4034. It replaces PN 12472170, which is shown as Item 3 in Fig 9 of TM 9-2320-397-14&P (Apr 00).

M1022 Dolly Set Cable NSN Corrections

The NSNs for the interdolly and intervehicular electrical cables shown in Table 2 of WP 0102 in TM 9-2330-379-13&P (Jun 12) are wrong. Get the interdolly electrical cable with NSN 6150-01-277-0089 and the intervehicular electrical cable with NSN 6150-01-277-0088. You should see these corrections in the next TM change.

HMEE III Contact Info

The new HMEE III backhoe loader, NSN 2420-01-532-3399, is managed under an interim contractor logistics support (ICLS) contract. If you need vehicle maintenance or repair info or special parts, email:

dpg@cnh.com

Or you can call (800) 388-6103 (CONUS) or (954) 968-0372 (OCONUS) for further assistance.

DISTRIBUTION: To be distributed in accordance with the initial distribution number (IDN) 340312, requirements for TB 43-PS-Series.

Would You Stake Your Life ^{right now} on the Condition of Your Equipment?