


MANDATORY REPLACEMENT PARTS FOR SHOCK ABSORBERS

THE HIMARS' TM 9-2300-310-14&P DOESN'T LIST ANY MANDATORY REPLACEMENT PARTS CRITERIA FOR THE FRONT SHOCK ABSORBERS.

AS A RESULT, THERE'S A CHANCE THE FRONT FRAME RAILS COULD BE BENT OVER THE RUBBER BUMPER ON THE FRONT LEAF SPRING.

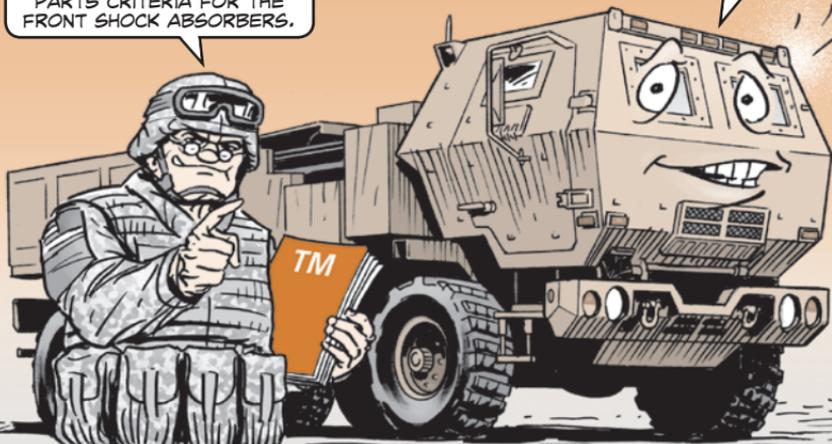

SO THE FOLLOWING PARTS MUST NOW BE REPLACED EVERY TIME THE FRONT SHOCK ABSORBERS ARE REMOVED OR REPLACED...

Fig 1231

Item	Name	NSN
1	Self-locking screw	5310-01-369-6706
3	M16 cap screw	5305-01-369-8253
4	Machine bolt	5306-01-369-8192
6	Flat washer	5310-01-369-8923
7	Self-locking nut	5310-01-369-3339

Fig 1232

Item	Name	NSN
1	Cap screw	5305-01-433-8469
2	Flat washer	5310-01-158-9053
3	Self-locking nut	5310-01-369-6706
5	Cap screw	5305-01-369-2264

IN ADDITION, THE SHOCK ABSORBERS, NSN 2510-01-372-4839, MUST NOW BE REPLACED AS PART OF THE BIENNIAL SERVICES.

THIS INFORMATION WILL BE ADDED TO TM 9-2300-310-14&P.