

WHEW!
IT TOOK ME NEARLY
A MONTH, BUT I
FINALLY GOT THIS
LITTLE STONE
MOVED A BIT!

NOT BAD FOR
A WORM, BUT
I STOPPED THAT
MASSIVE DOZER
JUST BY WALKING
AWAY!



SECURE HYDRAULIC LINES

Who would imagine that the lack of a small strap clamp could stop a 27-ton earthmover dead in its tracks?

But it has happened. And that's why you mechanics need to remember the clamp when servicing the five hydraulic lines mounted directly across from the engine's exhaust manifold.

The clamp is needed to keep the hydraulic lines from touching the ACE's hydraulic manifold. If a line touches the manifold when it gets hot, the line could melt and start a fire!

The clamp gets misplaced when a hydraulic line is replaced or the engine is pulled. If the clamp's missing, replace it with NSN 5340-01-179-7530. You'll find it listed as Item 40 in Fig 156 of TM 5-2350-262-24P (Jun 12).

Until the new clamp comes in, secure the lines away from the manifold with a tie-down strap, NSN 5975-00-570-9598.

