Alternative SHOCK for Armor

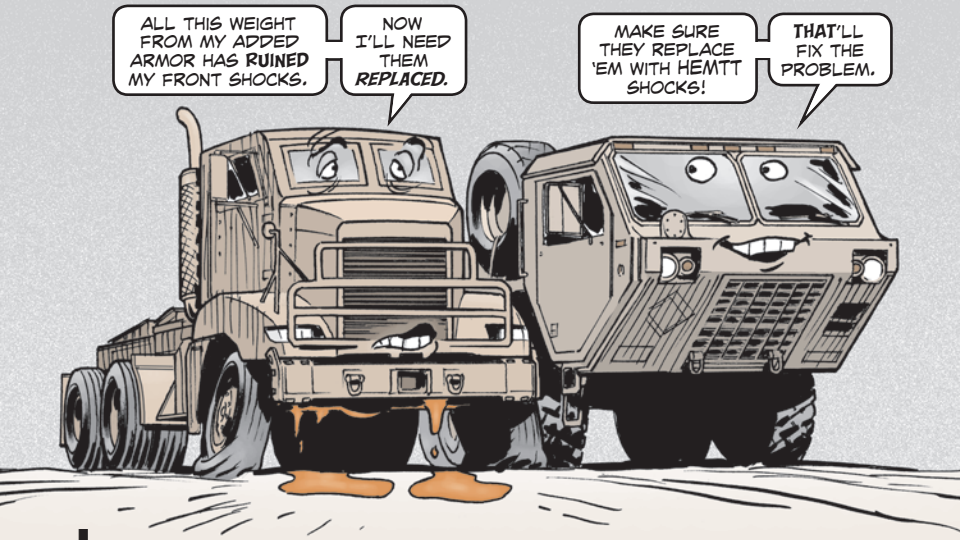

If your unit has up-armored M915A3 trucks, you may have already noticed that the front shocks, NSN 2510-01-479-1515, don't handle the added weight of the armor too well.

Some Soldiers have found busted shocks, leaking fluid and worn tires that need replacing too soon! But you can stop this.
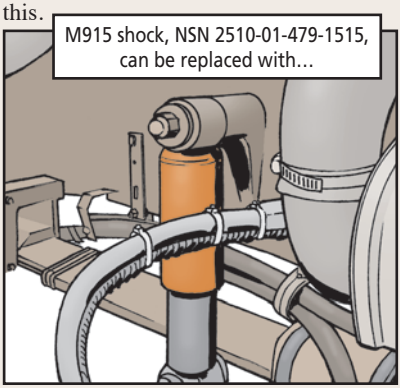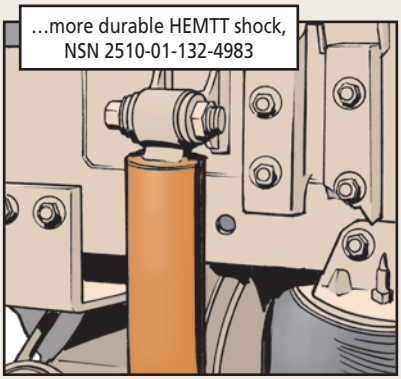
One unit at Ft Campbell discovered that installing HEMTT shocks, NSN 2510-01-132-4983, fixed this problem. This NSN brings the upper and lower bushings and the shock. It fits right on, too, so no mods are needed. Plus, TACOM LCMC approves this.