


Remove A-20 Before Welding?

*BEFORE
YOU DO ANY
WELDING ON
MY VEHICLE,
I *MAY* NEED
TO TAKE A
HIKE!!*

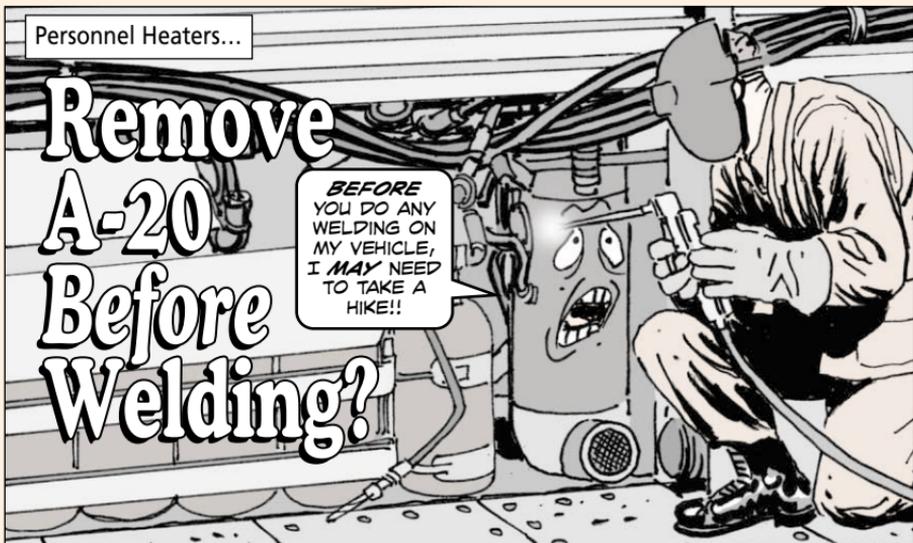


Got any electric arc or resistance welding scheduled for your combat vehicle? Better check to see if it's equipped with an A-20 personnel heater, NSN 2540-01-396-2826, first.

*IF IT IS,
YOU'LL HAVE
TO FOLLOW
THESE
GUIDELINES
BEFORE
WELDING.*




*OTHERWISE,
MY CIRCUIT
BOARDS
GET FRIED.*

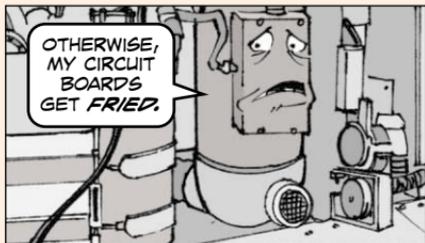

1. Disconnect the vehicle power cable at the heater's MS power connector, **not** from the control panel.
2. If the heater has any accessory items disconnect the cables.
3. Make the welding ground point as close as possible to the welding area.
4. If the heater is between the area being welded and the welding ground point, **remove the heater.**

Disconnect power cable from heater

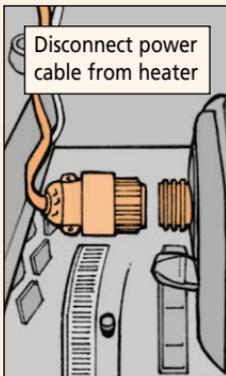

Disconnect accessory cables before welding

