




YOU COULD BECOME THE NOWHERE MAN IF YOU DON'T HAVE THE LATEST SOFTWARE INSTALLED IN YOUR PRECISION LIGHT-WEIGHT GPS RECEIVER (PLGR) OR THE ENHANCED (EPLGR) MODEL.



Old software could cause your PLGR/EPLGR to continually reset and the display to flash over and over. That would make your precision receiver not so precise!

Even if you haven't had these problems, check what software you're using. As you power up the PLGR/EPLGR, look for the 10-digit number. It will be on the third line of the first display. If you're already powered up, you can find the number on a status page by using the MENU key.

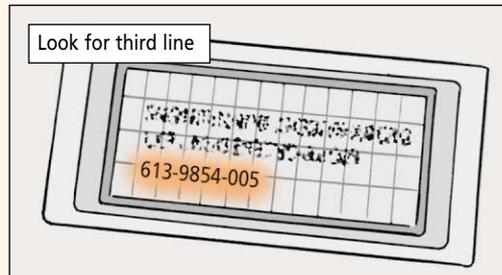

If you spot numbers 613-9854-005 or 613-9868-008, you're up-to-date and good-to-go. (PLGR+96 software version 613-9868-008 is the preferred operating system if the hardware will support it.)

Any other numbers mean you need new software. See your CECOM LAR for a copy of MWO 11-5820-291-30-4. The MWO lists the software you need, tells how to install it and authorizes you to do it. Your LAR should also have a copy of the new software.

If not, the software is available on the Internet at CECOM's software engineering directorate website. Go to:

<http://www.sed.monmouth.army.mil/RDIT/>

You'll have to register and get a password in order to download the software.

If you have any questions about the new software or how to get it, contact Willie Jackson at DSN 468-3518 or email: willie.jackson@robins.af.mil

If you have PLGR/EPLGR safety questions, contact David Kiernan at DSN 992-0084 or email: david.kiernan@us.army.mil

