


M1070 HET...

Keep Oil Lines Separate

IF THERE'S ONE
THING I CAN'T
STAND...


... IT'S
RUBBING OIL
HOSES!

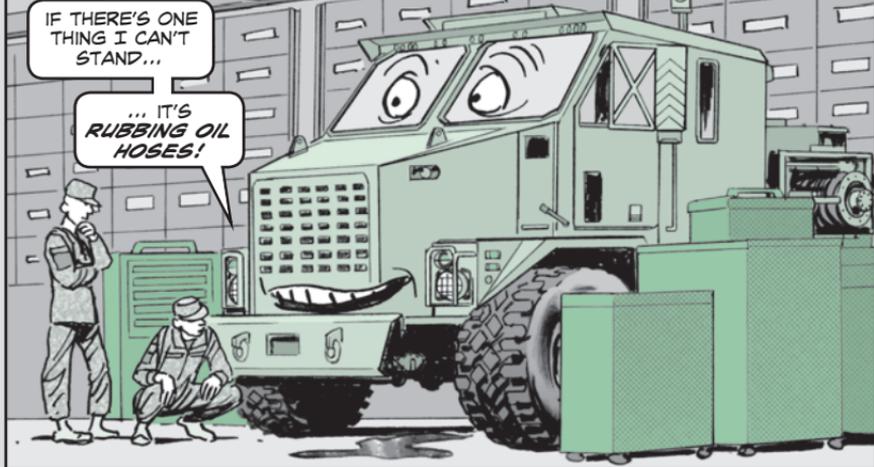

Dear Editor,

The angle of the oil return line on the rear of the M1070 tractor's air compressor allows it to rub against the transmission oil line just below it.

Enough rubbing results in a leak. And a leaking oil return line makes your truck NMC.

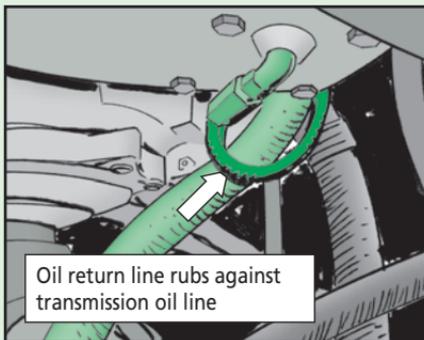

Oil return line rubs against
transmission oil line



Turn elbow fitting counter-
clockwise to prevent rubbing

We put a stop to this rubbing problem by turning the oil return line's elbow fitting, NSN 4730-00-231-4009, counterclockwise slightly. That raises the oil return line enough to keep the two lines from touching.

Curtis Knott
Technical Inspector
ITT/AMC Qatar

Editor's note: An excellent suggestion, Mr. Knott! Mechanics, snub those rubs by making this elbow adjustment.