

Underbody NMC Criteria Update

Dear Half-Mast,
I've heard that the underbody NMC criteria for M1151A1, M1152A1 and M1165A1 HMMWVs has changed. Can you tell me what those changes are?

SFC M.U.V.

Dear Sergeant M.U.V.,
Can do!

Item 44g in Table 2-2 of TM 9-2320-387-10 says that if your up-armored HMMWV is missing a retainer plate or more than one screw, your truck is NMC. That hasn't changed, but TACOM LCMC will **add** inspection criteria for your M1151A1, M1152A1 and M1165A1 HMMWV's underbody armor. This is because it has a unique attaching scheme.

The -10 TM will eventually be updated with the extra criteria. But while you wait for that to happen, note these additions, and keep a copy of this article with your TM.

Under these circumstances, your HMMWV is still mission capable:

1. One of two plates must remain on each of the group of two front underbody panels.
2. One of two plates must remain on each of the group of two rear underbody panels.
3. A total of up to four retainer plates may be missing provided that the conditions above are met.

Remember, this change **applies only to M1151A1, M1152A1 and M1165A1 HMMWV models!**


Make sure you follow the underbody NMC changes for M1114, M1116 and M1145 up-armored HMMWVs we put out on pages 18 and 19 of PS 667 (Jun 08). Here's the link to that article: <https://www.logsa.army.mil/psmag/archives/PS2008/667/667-18-19.pdf>

Half-Mast

DON'T FORGET THE FOLLOWING UNDERBODY ARMOR CHECKS WHEN DOING YOUR PMCS!



Front underbody panel plates and screws

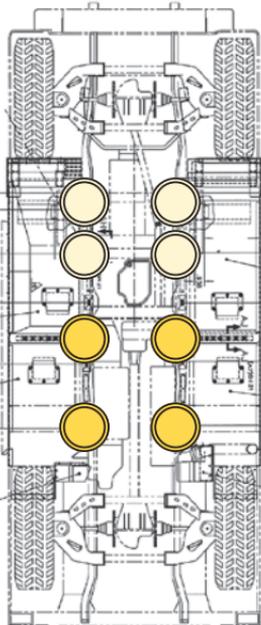

Rear underbody panel plates and screws