
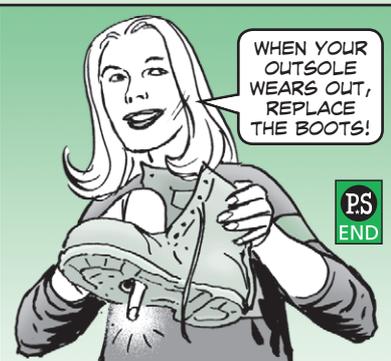


Outsole

Your boots come with a replaceable rubber lug outsole. Don't wear out the boots past the outsole into the softer midsole cushion. You could end up damaging your boots and injuring your feet. When the outsole wears out, replace the boots.

Outsole worn out? Replace boots

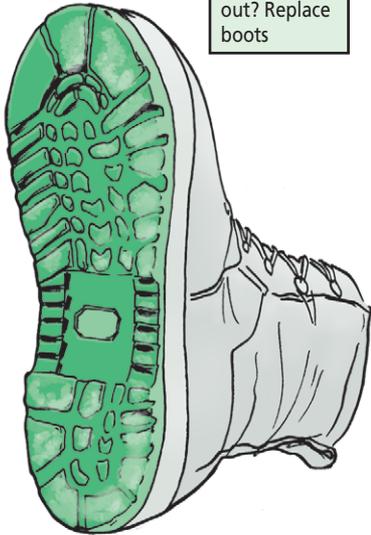

Connie's POST SCRIPTS

LIGHTWEIGHT HEAD WRAP

Need some light headgear to block the sun and sand? Try a Recon Wrap made by Spec-Ops®. The lightweight microfiber wrap can be worn in hot and cold weather. Use it as a sweatband, balaclava, neck gaiter, helmet liner, face cover, goggle cover or dust filter. The wrap is not in the Army inventory. But it is on a GSA schedule. Go to the GSA Advantage website:

<https://www.gsaadvantage.gov>

Once you get to the home page, do a search on the following part numbers:

Color/pattern	Part number
Black	100010101
Coyote brown	100010111
Digital camouflage	100010113

UH-60 Tail Rotor Blade Correction

On page 38 of PS 672 (Nov 08), the text and the balloons read "leading edge cracks." That's not correct. It should read, "trailing edge cracks."

MRAP MAC Chart

The commercial off-the-shelf manuals for GDLS-C and RG31A2 MRAP vehicles do not include the maintenance allocation chart.

You can get a copy of the chart online:

https://aeps2.ria.army.mil/commodity/mam/tacom_wn/08/GDLSRG31A2.pdf

HEMTT/PLS/HET Headlight Adjustment

The current headlight adjustment procedure in your HEMTT, PLS and HET maintenance manuals could leave the headlights aimed incorrectly. But TACOM MAM 08-050 outlines a new procedure to fix that problem. If you haven't eyeballed this MAM yet, view it online using this link: https://aeps2.ria.army.mil/commodity/mam/tacom_wn/08/mam08-050a.html

HMMWV RECAP Parts Update

In September 08, the HMMWV RECAP program started using the 4L80E 4-speed transmission and 6.5 NA engine. This change affects M1025R1 HMMWVs with serial numbers in the 560,000 series and M1097R1 HMMWVs with serial numbers in the 570,000, 670,000 and 770,000 series. TACOM LCMC is including an overpack list with each vehicle listing its unique parts. Keep the overpack list handy. You can also find the list in the HMMWV RECAP folder in the PM LTV Public Access Knowledge Center on AKO:

<https://www.us.army.mil/suite/doc/12499111>

REFRIGERATION KIT UPDATED

A supplement has been added to the Army's refrigeration kit, NSN 5180-00-596-1474, that lets repairmen work with refrigerants R404a, R407a, and R410a. The supplement, NSN 5180-01-561-6082, has been added to component list 5180-95-N18. The supplement was specifically created for the mobile integrated remains collections system and the multi-temp refrigerated container system, but it can be used for other systems that use these refrigerants.

M113A3 FOV IDLER ARM ROLLER BEARING

Use NSN 3110-00-100-5328 (PN 28584-28521, CAGE 60038) to get a new idler arm roller bearing for your M113A3 FOV. NSN 3110-01-516-0687, which is shown as Item 12 in Fig 165 of TM 9-2350-277-24P (Oct 03), is no longer available.

DISTRIBUTION: To be distributed in accordance with the initial distribution number (IDN) 340312, requirements for TB 43-PS-Series.

Would You Stake Your Life ^{right now} on
the Condition of Your Equipment?