

# LRU Seal Stays Sealed




The good news is that eight Bradley line replaceable units (LRU) are being fielded that are covered by warranty at the wholesale level. That means if they quit working, you can turn them in through your normal supply channels and receive credit for a new LRU.

The bad news is that many Bradley units don't realize that. Currently, a large percent of the LRUs being turned in have broken seals and thus voided warranties. This results in higher prices for the LRUs, a higher number of back orders, and a longer repair turnaround.

Part of the problem is that the old LRUs could be repaired at unit level, so repairmen assume the new ones can be repaired there, too.

But it's easy to spot the new LRUs. They have tamper-resistant seals that say "CPU TECH" or "WARRANTED ITEM, WARRANTY IS VOID IF SEAL IS BROKEN. RECOVERABLE ITEM—NO REPAIR AUTHORIZED." Removing the LRU cover breaks the seal—and voids the warranty.

The LRUs covered by warranty should be turned in for repair through normal supply channels. The old LRUs can still be fixed by field maintenance.

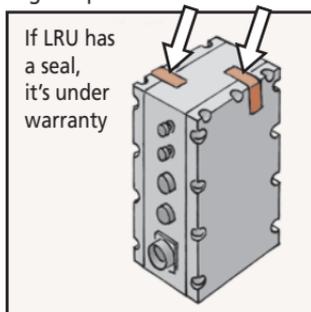

HERE'S A LIST OF THE NEW LRUS COVERED BY WARRANTY...

LRU	New P/N	NSN
Position indicator box (PIB)	12992057	1290-01-508-7223
Gun control unit (GCU)	13007291	1005-01-541-7231
System control box (SCB)	12992083	1005-01-541-9684
Commander's sight control panel (CSCP)	12992085	5895-01-541-8031
Gunner's sight control panel (GSCP)	12992093	5895-01-541-8030
Power control module 1 and 2 (PCM 1/2)	12992098	1010-01-541-9685
Power control module 3 (PCM 3)	12479532	1650-01-542-1185
Turret power box (TPB)	12992104	1010-01-541-9683

If you have questions about the LRUs, contact TACOM-RI's at DSN 793-8628, (309) 782-8628, or email:

[@us.army.mil](mailto:us.army.mil)