

Dump Trucks...

HOIST CYLINDERS SHOULD LEAK!




It's no secret that hydraulic hoist cylinders on M929- and M930-series dump trucks are known to leak. Some leak just a little, others leak a little more. Matter of fact, they're supposed to!

Your truck is not NMC unless the leak adds up to more than a quart a day, or the cylinders won't lift an empty dump body.

That's because single ram cylinders must leak enough to keep the cylinder rod coated with oil and the seal wet. The oil protects the rod from the elements and corrosion.

Telescoping cylinders, like the ones on these dump trucks, have seals at each section of the cylinders that leak for the same reason.

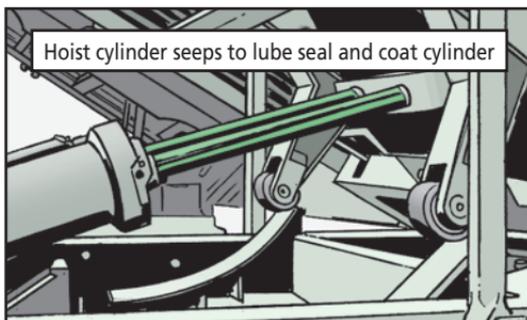

SINGARS External Antenna Connector

The external antenna connector, NSN 5935-01-386-0360, for the RT-1523, -1523B and -1523C has been changed. It's now a snap-on connector instead of one that needs to be soldered. But it needs a new internal circuit card. Order both the new card and the connector with NSN 5895-01-384-4645.

Bookmark Battery Calculator Site

The Army's rechargeable battery program has a downloadable battery calculator called POWER. This calculator helps you determine the right battery for the equipment and the job. This site is updated often and recently has added more battery runtimes. So, add this site to your list of Internet favorites and check it often:

<https://www.monmouth.army.mil/cecom/lrc/lrchq/power/rechargeabat.html>