


# Master Cylinder Brake Fluid Fix

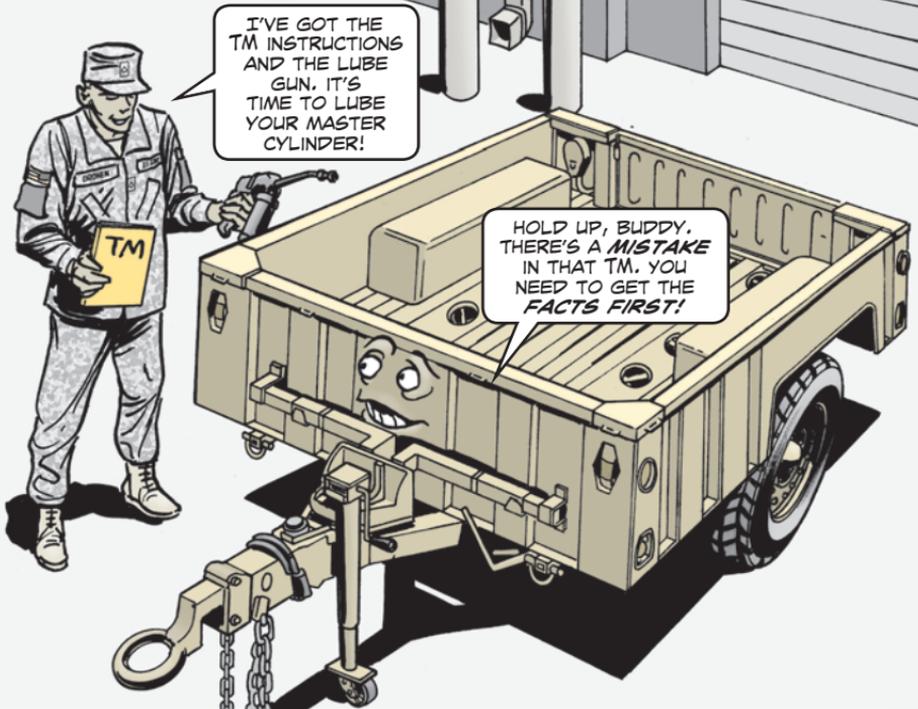

Dear Editor,

I found a mistake in TM 9-2330-392-14&P. Step 3 of the Notes section on Page G-6 in Appendix G gives lube instructions for the master cylinder. It says "semiannually, or as required, fill to within  $\frac{1}{8}$  inch (3 mm) of top edge of reservoir." But doing this won't allow for expansion of the brake fluid!

To allow for expansion, the TM should be changed to say "semiannually, or as required, fill to about  $\frac{1}{8}$  inch (3 mm) below the bottom of the reservoir filler neck."

I've already submitted a DA Form 2028 to TACOM LCMC, and they agree with me. Until they can update TM 9-2330-392-14&P, you might want to get the word out to your readers.

Lewis W. Eoff  
TACOM LAR  
1st Calvary Division  
Fort Hood, TX

**Editor's note:**

You just told 'em, Lew. Thanks. Readers, make a note until the TM is changed.