


M777A2
Towed
Howitzer...

KEEP TOWING LUNETETTE TIGHT



A LOOSE LUNETETTE ON YOUR M777A2 HOWITZER'S MUZZLE BRAKE CAN CAUSE NO END OF PROBLEMS!

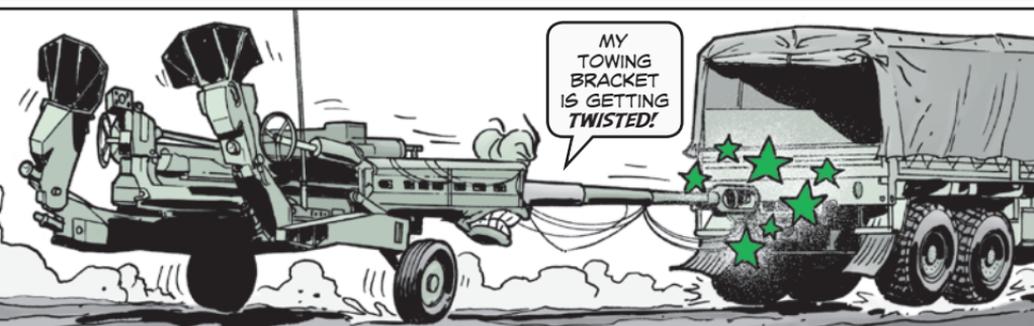

If the lunette isn't tightened down properly, it allows a twisting motion during towing. It doesn't take too much twisting to damage the muzzle brake's tow bracket. The fix requires a depot-level welding and re-machining of the bracket.

You can prevent that expensive damage by making sure both the washer, NSN 5365-01-528-9349, and long nut, NSN 5310-01-528-9347, are in place. Then keep the long nut torqued to 350 lb-ft.

