


POWER STEERING CAP'S A REAL MISHAP!

I'M THE
NEW CAP
IN TOWN!

GUESS
I'M **OUTTA**
HERE!

TAKE YOUR
LEAKY SELF
AND **GIT!**

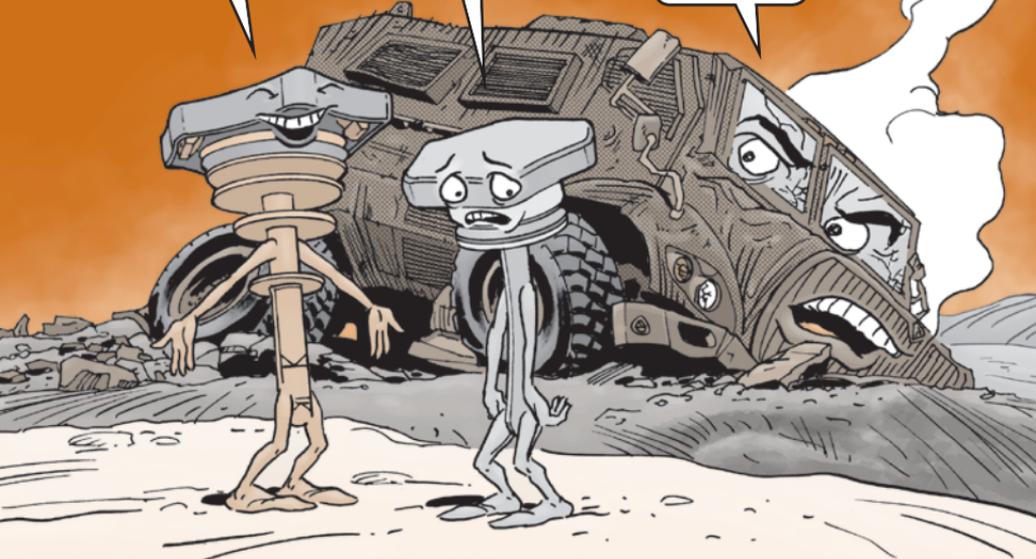

A loss of power steering fluid will cause the MaxxPro to steer hard or erratic during operation—or not at all!

The culprit is usually the vehicle's original power steering reservoir cap, NSN 2590-01-556-5316. It's a known leaker.

To stop fluid loss, replace the old cap with a new style cap. The new cap, NSN 6680-20-006-4251, has three baffles on its dipstick that keep fluid from seeping past the cap.

So eyeball the cap you have on your MaxxPro. If it's the old-style cap, replace it now.

