


Replace CTIS Air Valve Nipple

One of the items most often broken in the central tire inflation system on M939A2-series trucks is the nipple on the wheel inflation turret valve.

That's because it's right out in the open where soldiers put their big feet when they climb on board from the side.

In the past, it was \$12+ to replace the turret valve because the nipple wasn't available as a repair part. Now you can save at least \$10 by ordering the nipple—called a pneumatic tank valve, NSN 4820-01-119-8862.

Now that you've saved some money, help save yourself some repair time by convincing soldiers to climb in from the rear of the truck using the tailgate.

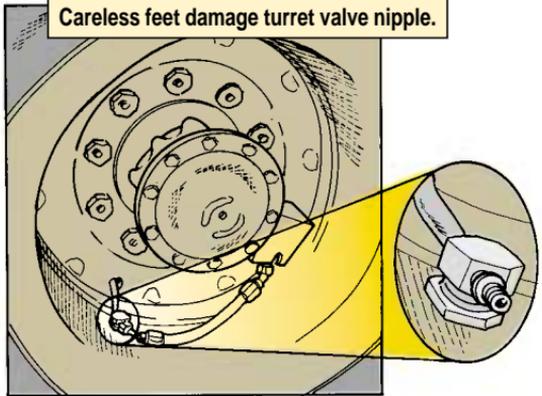

Careless feet damage turret valve nipple.

