


Matching Hub Info

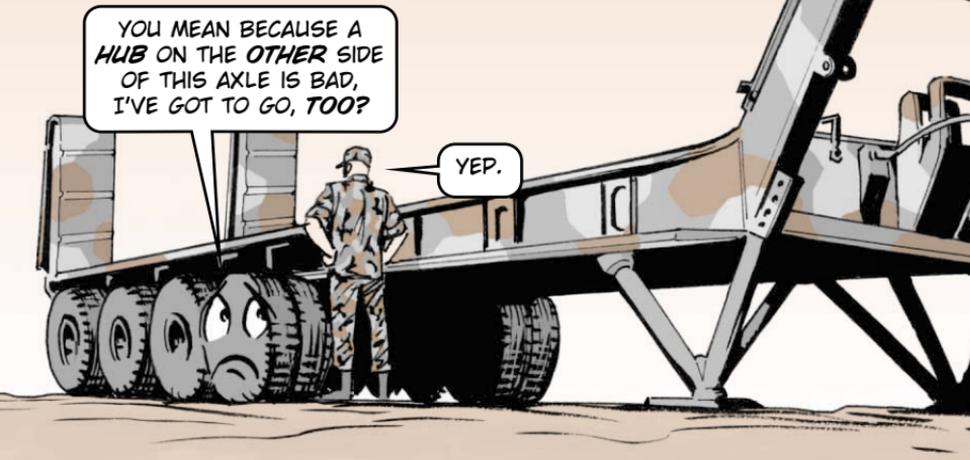

Mechanics, hubs for early model M747 semitrailers (serial numbers 1-200) are no longer available.

If a hub goes bad, you have to order two complete new hub and wheel assemblies—one for each side of the axle.

You can't run the old wheel and hub assembly on the same axle with the new one. They are not the same size. But you can run both types on the same trailer.

The new hub is the B type used on M747s serial numbered 201 and higher.



**OTHER PARTS—
BEARINGS,
SEALS AND
BRAKE PARTS—
ARE THE SAME
FOR BOTH
WHEEL DRUMS.**

ITEM	QTY per axle	NSN
Hub	2	3040-00-351-2581
Brake drum	2	2530-00-319-5720
Wheel stud	20	5306-01-014-7481
Lug nut	20	5310-00-538-0800
Wheel Assembly	4	2530-00-355-7763

M1000 Semitrailer Tire

The only tested, approved and authorized tire for the M1000 semitrailer is Michelin LT215/75R17.50 P-metric radial, NSN 2610-01-323-4813, load range H. This tire rated best for off-road **and** highway use in TACOM tests.