

RL-207 Reeling Machine...



UPGRADE THE ENGINE



The Mil-Std engine for the RL-207 reeling machine, NSN 3895-00-892-4583, has been replaced with NSN 2805-01-169-1100.

Check the engine data plate. If you have part number 2A016-4, you have the upgraded engine. If you have part number 2A016-1, -2, or -3, order the new engine when you need to replace the old one.

While you're looking at the engine data plate, check out the upper and lower V-belts. Both of these belts should be smooth—no teeth. If you have one with teeth, replace it. It could grab and cause injury or equipment damage. NSN 3030-01-290-1371 brings the upper belt. NSN 3030-01-158-7527 brings the lower belt.

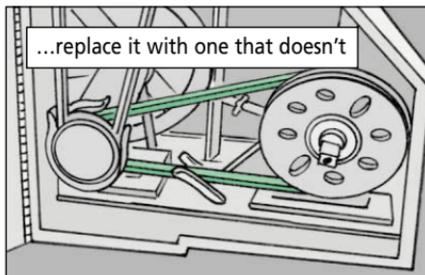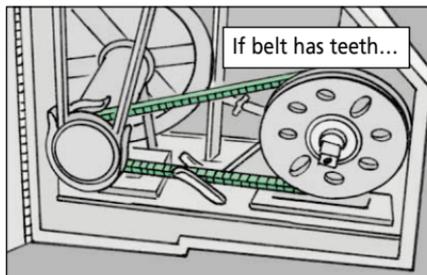

One final point: these reels are machines and they need to be lubed and preventive maintenance needs to be done. Too many of these reels are sitting out in the weather and are being neglected. Get your RL-207 in tip-top shape and it will be ready to do your reeling job when called on.