

D7G Tractor...

Clamp the Hose Rub

MECHANIC!
CAN WE GET
A MECHANIC
OVER HERE!!!

ARGHHH!
I'M LOSING
HYDRAULIC OIL
LIKE CRAZY!

**OHH, IF ONLY
MY OPERATOR
HAD CHECKED
MY CLAMP!**



Mechanics, the hydraulic hoses that mount next to the roadside edge of the radiator grill can end up with a raw deal.

There's a clamp that holds these hoses in place. Sometimes the clamp gets misplaced when the hydraulic lines are replaced, or when the engine is overhauled by support. Without the clamp, the hoses rub against the grill's guard frame when the dozer's blade is raised or lowered.

Enough rubbing causes the hoses to spring a leak. That means the dozer's blade is out of commission. Without hydraulic oil, it won't retract, elevate or push dirt forward.

Before the day's run, eyeball the hydraulic hoses where they pass through the radiator grill.

Is the clamp snug against the hoses? Is it missing? If so, order a new clamp with NSN 5340-01-258-0942.

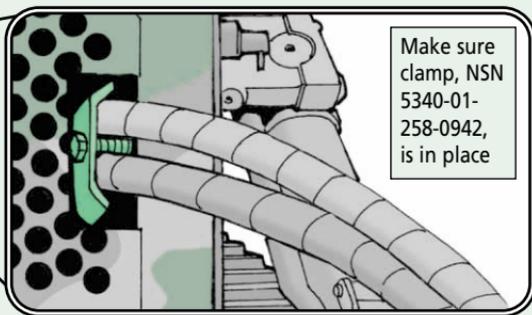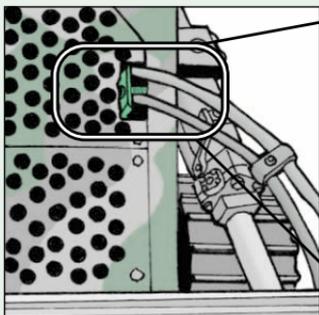

Make sure
clamp, NSN
5340-01-
258-0942,
is in place