


STOPS STOP SWINGING ISU DOORS

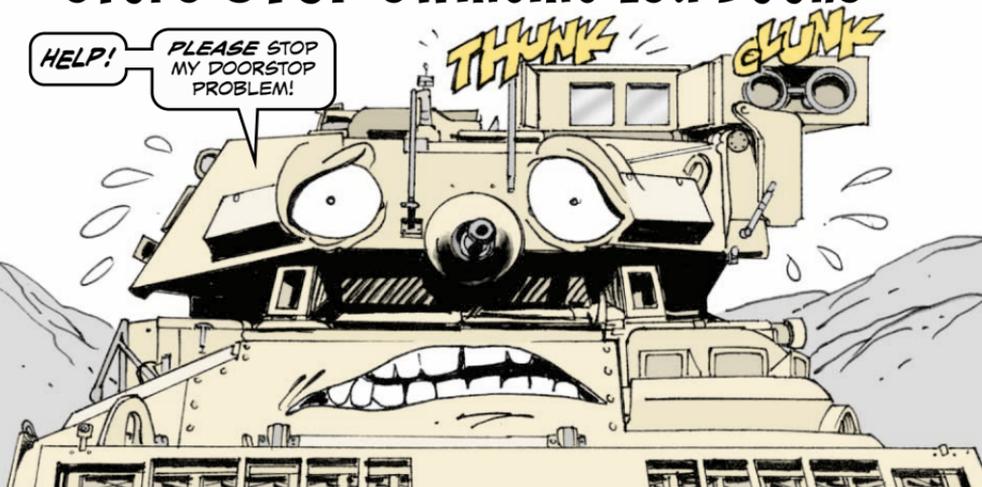


If the doors for your Bradley's integrated sight unit (ISU) swing open too far, you could be headed out the door when it comes to the ISU.

A left door that opens too far hangs up on the TOW launcher and a right door with the same problem catches on the secondary sight when the M242 gun is raised. Soon the ISU doors are bent and can't be opened from inside the Bradley.

If the ISU doors don't stop where they're supposed to, the problem is either missing or incorrectly installed doorstops or catches. They're removed when the door cables are adjusted and sometimes repairmen forget to put them back on or put them on wrong.

During your WEEKLY PMCS, make sure the ISU doors don't swing all the way open. If they do, tell your repairman.

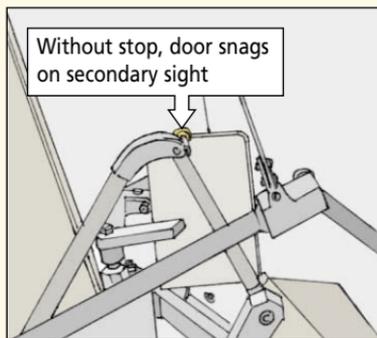

YOUR REPAIRMAN CAN GET A DOORSTOP FOR THE **RIGHT DOOR** WITH NSN 5340-01-318-9854...

AND A CATCH FOR THE **LEFT DOOR** WITH NSN 5340-01-313-4781.