

# CABLE CRUSHING CONCERNS

YOUR NEW DRIVER'S VISION ENHANCER CABLE IS HERE!

A FEW CABLE TIES MIGHT KEEP IT IN SERVICE LONGER!


A recent modification to the Stryker moved the driver's vision enhancer (DVE) to a new position higher up on the vehicle. The modification also included a longer, 6-ft cable to reach the DVE screen.

The cable is routed alongside a metal bar that runs between the driver's hatch and the engine access hatch. It's held in place with cable ties.

Problem is, those cable ties can wear out. If that happens, the cable moves around and can get caught in either of the two hatches. **CRUNCH!**

Check the cable ties periodically for damage. Replace any that are broken or missing with NSN 5975-00-985-6630.

Five wire ties are needed to keep DVE cable out of danger

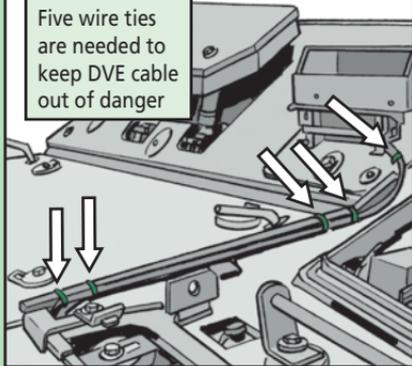

Mechanics, if you have to replace a damaged cable, don't forget to secure the new one with cable ties. Otherwise, you'll soon be replacing the cable again.