

# NEW CLEANING COMPOUND



**M**echanics, don't waste time ordering the corrosion cleaning compound, NSN 6850-01-339-5227, listed on EM 0126, TM 1-1520-Longbow/Apache. It's been discontinued.

Instead, order the replacement cleaning compound with NSN 6850-01-433-0873. Make a note until the next update to TM 1-1520-Longbow/Apache, EM 0126.

Also, remember to check out Chapter 2 of TM 1-1500-344-23-4 for other consumable materials for corrosion control.

## NEW RESISTORS FOR AH-64 SIMULATOR

**T**o improve performance, the resistors for the AH-64 A/D's rocket launcher simulator have been upgraded from 1-ohm, 1/2 watt to 100-ohm, 1/2 watt. Order the new resistors with NSN 5905-00-106-9344.

You'll need 19 of them. Update Appendix D in TM 9-1090-208-23-1-2 and attach documentation to IETM 1-1520 Longbow/Apache with the new info.


### ROCKET LAUNCHER SIMULATOR

MS3470L16-26P 

These resistors should be upgraded

A B C D E F G H J K L M N P R S T U V Y Z a b c

100Ω  
1/2W

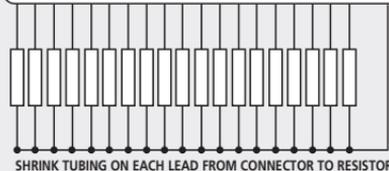

#### PARTS REQUIRED

QUANTITY	DESCRIPTION	PART NUMBER
1	CONNECTOR	MS3470L16-26P
19	RESISTORS, 100 OHM 1/2 WATT	RCR20G101JS

 MS3120E16-26P OR MS63110E16-26VP MAY BE USED AS AN ALTERNATE