
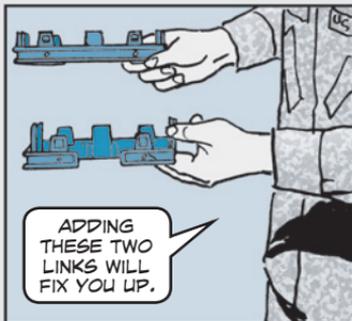


GOT GUN PROBLEMS?

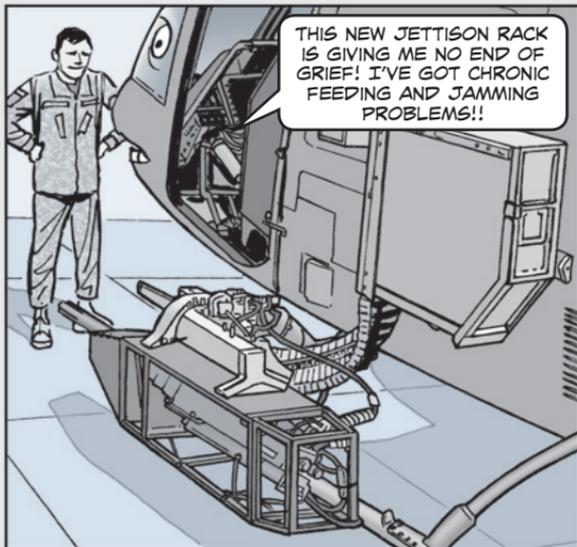

Dear Sergeant Blade,

As armorers, our Kiowa Warrior's M296 .50-cal machine gun has had some feeding and jamming problems since the installation of the new gun jettison rack, NSN 1095-14-553-8310.

Because the gun sits lower with the new jettison rack, the ammo chute is too short, causing feeding problems for the rounds. The chute is not as flexible and a little too short with the new rack.

We've come up with a simple solution to stop gun jams. We added two extra links, NSN 1010-01-368-0242, to the end of the chute to get the rounds to feed properly into the gun.

Since we've added the links, the gun operates without any problems.

SPC J.S.

Dear Specialist J.S.,

Good job! Looks like you found the missing links to solve this problem.

*Rotor
Blade*

