


# DO YOU HAVE A CHAFING PROBLEM?

So, your 100-kW tactical quiet generator is humming quietly along and then suddenly, it's TOO quiet. It's stopped running! The generator set control (GSC) display is blank and so is the digital voltage regulator (DVR) display.

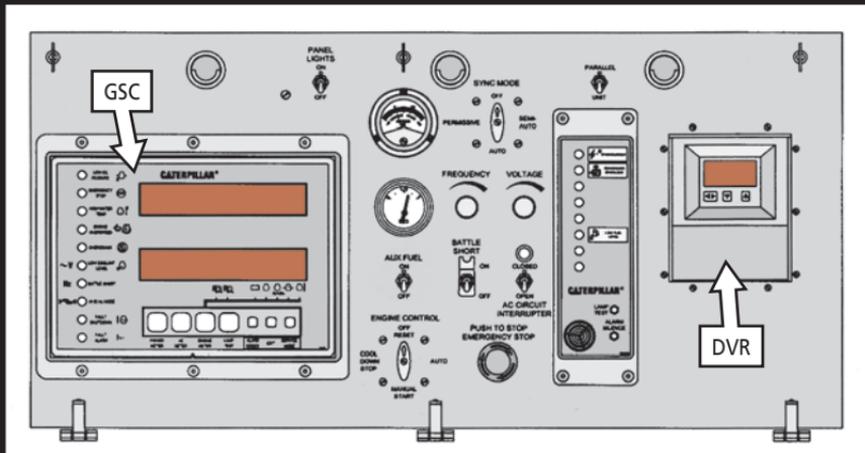

## What's wrong?

One of the things it might be is a blown 10-amp fuse that sits behind the GSC.

Check it. If the fuse is blown, then check for another problem—a chafing problem. Open the right rear access door and look at the input wires to the slave relay (SRY). Are they rubbing against the main generator lifting eye? Do you have wires making metal-to-metal contact and blowing that 10-amp fuse?

If you have a chafing problem, wrap the chafed wire with electrical tape and then spiral wrap, NSN 9330-01-466-2483. To further hold the wiring bundle together and off of the lifting eye, use a zip tie, NSN 2920-01-058-9099.

Replace the blown fuse with NSN 5920-00-243-3787.

