


# GET THE DIRT OUT!

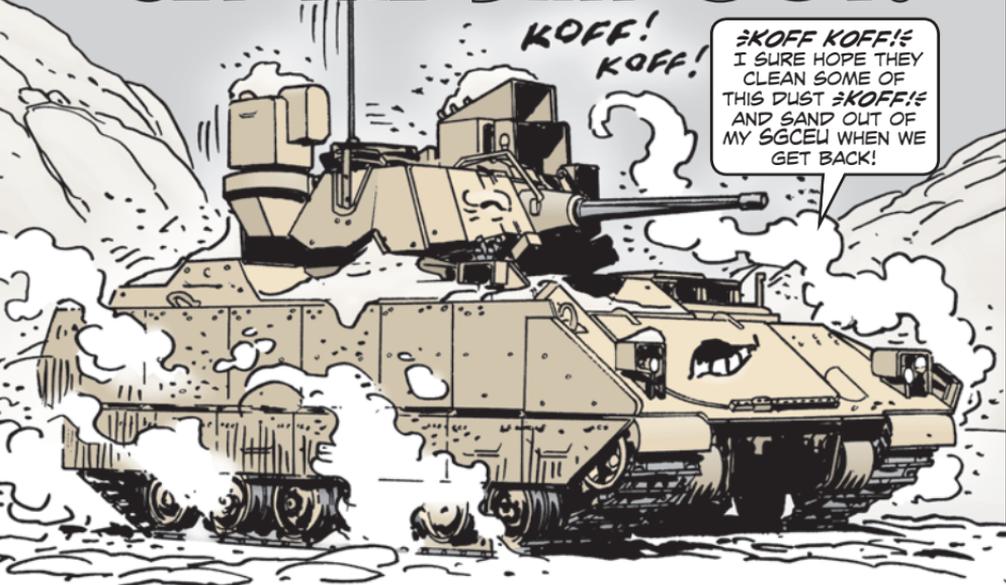

Some periodic housecleaning goes a long way towards keeping your Bradley's second generation common electronics unit (SGCEU) on the job, crewmen.

The SGCEU's cooling fan pulls in a lot of sand and dirt, gunking up the insides. Pretty soon, the cooling fan is fighting a losing battle. The SGCEU overheats and fails.

Before that happens, you should remove the SGCEU from under the turret floor. Then blow out the sand and dirt that has accumulated inside the unit with low-pressure (30 psi) dry air.

Since the unit is coded for Depot repair, you can't remove the cover. So blow the unit out at the fan opening. How often you clean it depends on your location. In Iraq, it should probably be done every few days.

