



CLEAN SLIP RING IN SEGMENTS



Dirt, sand, oil, and condensation have a habit of collecting on your Paladin's slip ring, crewmen. As the turret is traversed, that crud builds up on the segment board and shorts it out. Things go downhill from there. A shorted segment board shuts down your commo and the vehicle motion sensor. You'll also get navigation faults in the automatic fire control system.

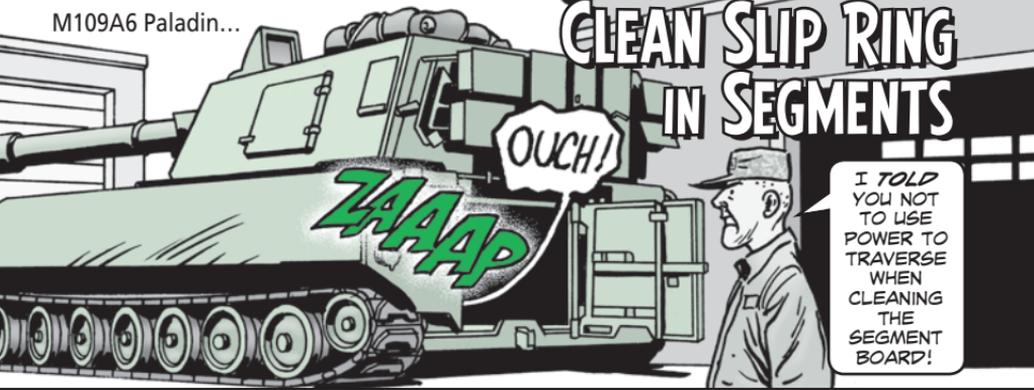

1. Remove the cover plates over the segment board.

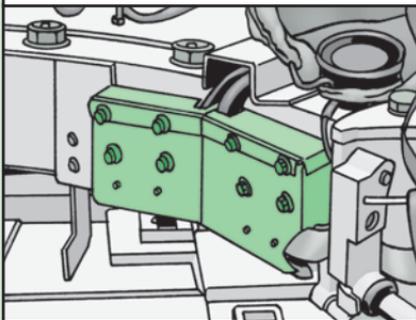

2. Soak a nylon scrub pad, NSN 7920-00-753-5242, with denatured alcohol and clean the exposed portion of the board.



3. Wipe the scrubbed area of the board again with a clean cloth

4. Manually traverse the turret enough to expose the next portion of the segment board and clean again. Keep manually traversing until the entire board is clean. Watch out, though! Using power to traverse the turret will give anyone cleaning the segment board a big *shock!*