


Up-armored
HMMWVs...

CONDENSER FAN ASSEMBLY CHANGES


AN UPGRADED REAR AIR CONDITIONER CONDENSER IMPROVES YOUR M1151, M1152, AND M1165 BASIC AND -A1 UP-ARMORED HMMWVs.

THIS NEWER CONDENSER ALLOWS FOR MORE CLEARANCE, HAS A BEEFED-UP CLOSEOUT PANEL, AND SHOULD CURB POTENTIAL DAMAGE.

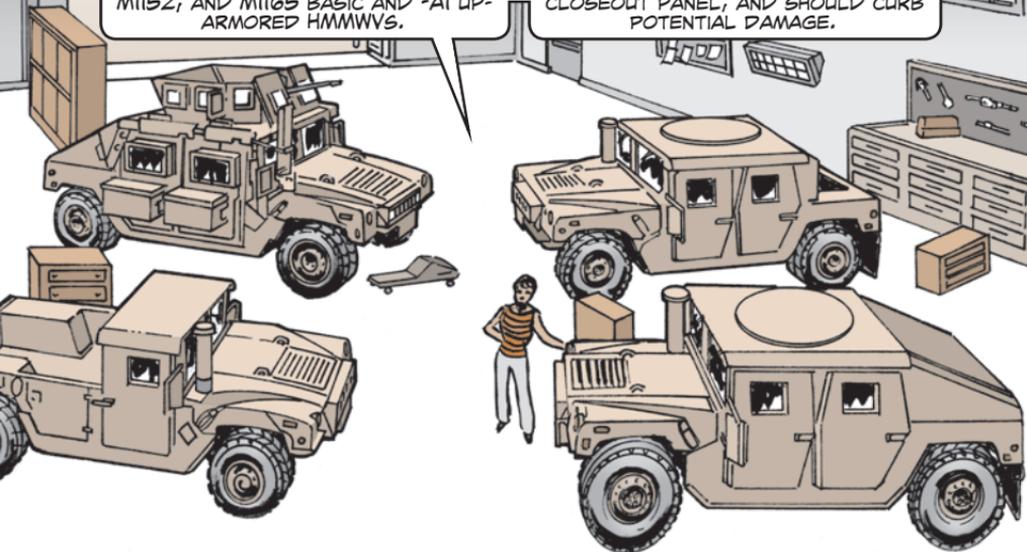


The original rear condensers, NSN 4130-01-537-4847 and NSN 4130-01-536-5561, are no longer available. But you can get the replacement condensers, closeout panel and related hardware in upgrade kits that TACOM LCMC assembled.

Replacement condensers come in kits

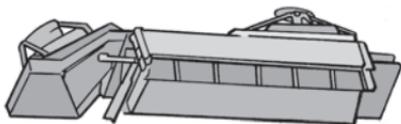

Improved rear condenser allows for more clearance and has stronger panel

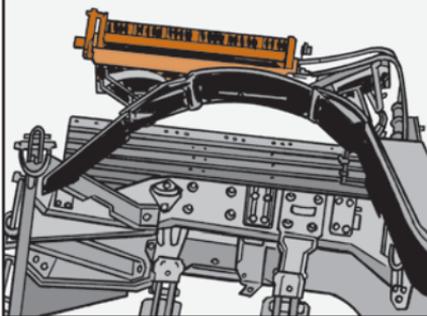

Order the left-hand rear condenser kit using NSN 2540-01-558-3448, and the right-hand rear condenser kit using NSN 2540-01-558-3450.

Two fans that pull the air through are mounted underneath the condenser. Get the front condenser fan with NSN 4140-01-548-2496 and the rear condenser fan using NSN 4140-01-548-1171.

Make a note of these NSNs in the TM until it's updated.