


# Get the Fit You Need

I REALLY  
NEED THAT NEW  
GENERATOR!

COULD YOU  
GO A LITTLE  
FASTER?

PATIENCE,  
MY GOOD  
BRADLEY!

YOU DO WANT  
THE PROPER FIT,  
DON'T YOU?

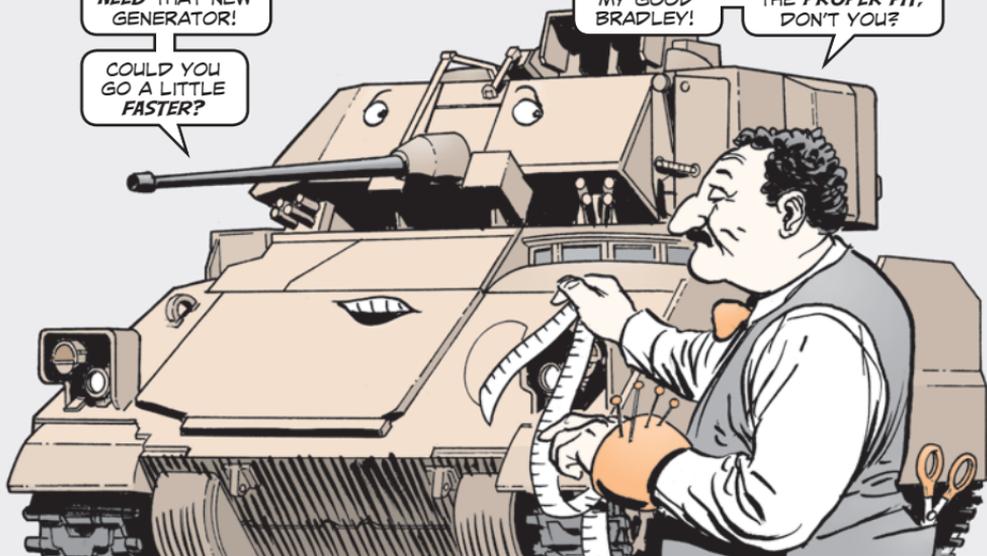

**W**hen the time comes to replace the generator on your Bradley, fit is pretty important! If you're trying to install a Niehoff 400-AMP generator, NSN 6115-01-562-6264 (PN 12386631-1), you could run into problems. The generator's housing may come into contact with the transmission output housing oil port plugs. That keeps you from bolting it in place properly.

Sure, you might be able to force or massage the generator into place, but you'll only get a damaged generator for your trouble.

A new generator is available that was designed to fit much better. Problem is, it still has the same NSN and part number as the ill-fitting generator. The only way to tell the two generators apart is by the color of the fan shroud and the addition of a safety decal.

The new and improved generator has a red fan shroud. If your generator has a black shroud, replace it.

Questions? Contact TACOM's Gregory Nicholson, DSN 786-8942, 586-282-8942, or email:

[gregory.r.nichelson.civ@mail.mil](mailto:gregory.r.nichelson.civ@mail.mil)

New, improved generator has red shroud

