
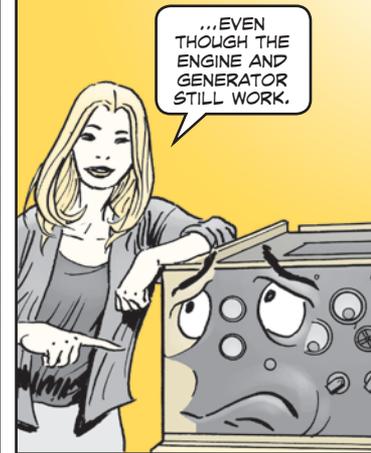
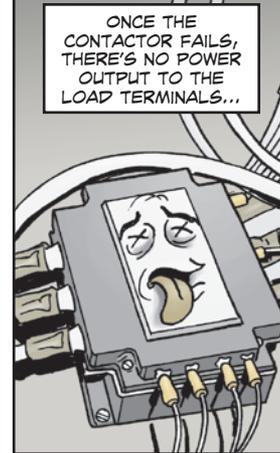
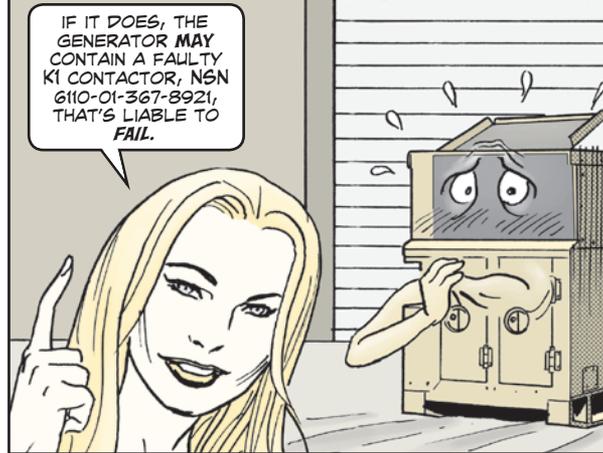



# CONTACTOR FREE OF CHARGE

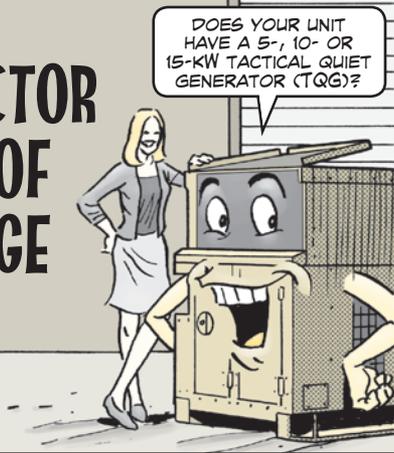

## Identify the Faulty Contactor

The K1 contactor is located in the TQG's output box. Here's how to identify a bad one:

- The contactor's cover is shaped like a "+."
- Look for a brown label with AMETEK printed on it. Ametek, Inc., manufactured the bad K1 contactors.

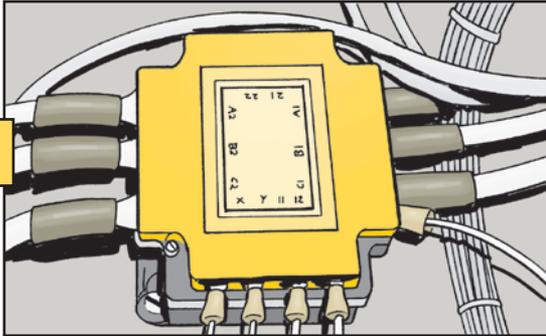

- In the label's lower right corner is the MFG DATE (date of manufacture). The first two digits represent the week; the last two digits represent the year. Look for MFG DATES from 40/10 through 13/11. Ametek K1 contactors manufactured during this time are potentially faulty and should be turned in.

<b>AMETEK®</b>		
<b>PRESTOLITE POWER AND SWITCH</b>		
<b>JAG-6008</b>		
CURRENT Amp <b>150/POLE</b>	FREQHz <b>400</b>	CONTACTS <b>3PST NO</b>
OPERATING VOLTS <b>28 VDC</b>	MAIN CONTACTS VOLTAGE VAC <b>115/200</b>	MFG DATE <b>40/10</b>

## A Free Contactor

HERE'S HOW TO GET A REPLACEMENT **FREE OF CHARGE...**



1. Phone CECOM LCMC's Brian Sohosky, DSN 648-6989, (443) 395-6989, or email: [brian.g.sohosky.civ@mail.mil](mailto:brian.g.sohosky.civ@mail.mil), or Scottee Welsh, DSN 648-6950, (443) 395-6950, or email: [scott.m.welsh2.civ@mail.mil](mailto:scott.m.welsh2.civ@mail.mil)  
Let them know you have a failed contactor. Give them the following information:
  - DODAAC
  - unit identification code (UIC)
  - point of contact
  - phone number
  - Transportation Account Code (TAC) funding
  - number of contactors you want shipped to you
2. CECOM LCMC will notify the West Virginia National Guard (WVNG), who is storing replacement contactors. WVNG will ship replacement contactors to customers who have defective ones.
3. Once your unit receives the replacement contactor, you must ship the failed contactor to Ametek. A prepaid shipping label is included inside the free issue box with the replacement contactor. You must use the same shipping box to ship the failed contactor. The return label lists the following ship-to address:
 

**AMETEK Power Instruments**  
**Manufacturing Manager—Jesus Torres**  
**1701 Industrial Blvd**  
**Hildago, Texas 78557**  
**Phone: 956-843-4070**  
**Fax: 956-843-4534**  
**Cell: 956-605-3017**
4. CECOM LCMC's LARs in the field will provide a service bulletin containing contactor inspection, removal and installation instructions.