

M1074, M1075 PLS...

MUD FLAP HANGER KIT FLAP

HEY! MY MUD
FLAP BRACKET
IS **LONGER**
THAN YOURS!

YOU'RE
RIGHT!
WHAT'S
GOIN' ON?


CALM DOWN, YOU TWO.
ONCE THE LONGER ONE'S
MODIFIED, THEY'LL BE
EXACTLY THE SAME!



Mechanics, when you order a new mud flap hanger bracket kit, NSN 5340-01-383-2457, for your palletized loading system (PLS) truck, don't be surprised if the left- and right-hand brackets you get are a little longer than the originals.

These brackets are now made by two different vendors. The brackets made by the second vendor are about three inches longer than the originals.

If you receive the longer brackets, you'll need to modify them. Just cut off the last three inches of both brackets. Then remove one clip from each bracket so that only three clips remain. Weld the end clip flush to the end of the hanger.

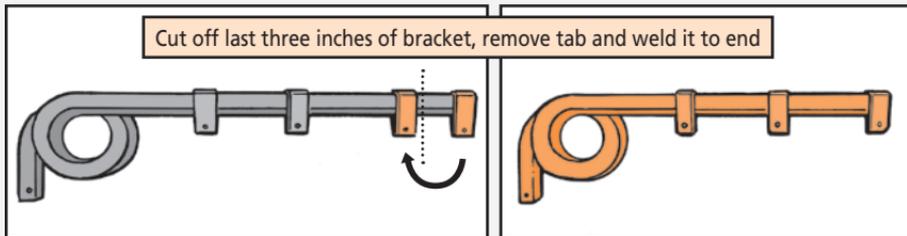

M1074A1 and M1075A1 PLS...

HOW TO GET TWO-PIECE HYDRAULIC HOSE

The old, one-piece hydraulic hose, NSN 4720-01-567-7068, shown as Item 56 in Fig 802 of TM 9-2320-319-13&P in IETM EM 0298 (Mar 10), is no longer available for your PLS. You must now order the hose as two separate pieces, one metal and one rubber.

NSN 4710-01-566-4665 gets the metal hose. However, there is no NSN available for the rubber hose (PN 3808531). You'll need to order it directly from Oshkosh. Call 1-800-392-9921 or email:

partssales@defense.oshkoshcorp.com

Metal hose,
NSN 4710-01-566-4665

