

HERE'S A TIP ON HOW TO
MORE EASILY REASSEMBLE
YOUR M240.




Prevent Ejection Port Dejection


Dear Editor,

The M240's TM 9-1005-313-23&P (Dec 07) is a bit vague on how to reassemble the ejection port cover assembly. Here is what I've come up with to do the job:


- With the ejection port cover open, turn the M240 upside-down.

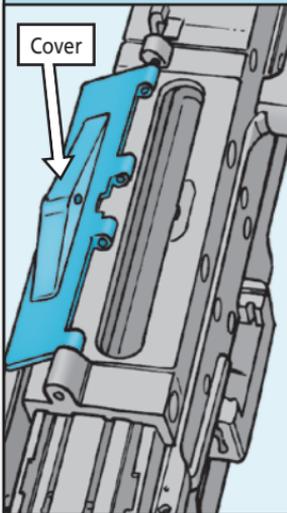

- Insert the detent inside the ejection port cover.

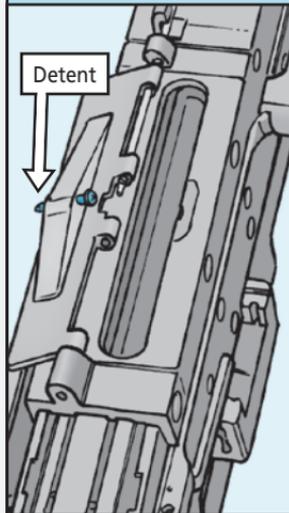

- Insert the ejection port cover pin $\frac{1}{4}$ of the way through the cover and spring.

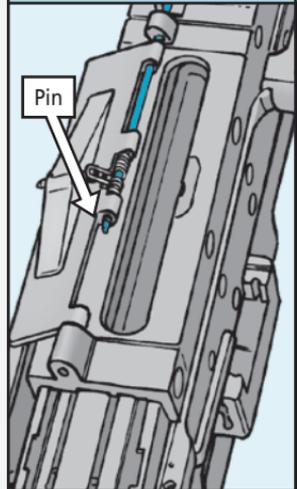

- The spring must have tension to hold properly. If the spring needs tension, start one end of the spring into position and turn the other end $\frac{1}{4}$ turn.
- Slide in the rest of the cover pin. Use a flat-tip screwdriver to push the other end of the spring finger into place.

Kevin Johnson
TACOM LCMC
Ft Polk, LA

Editor's note: *Thanks for the tip, Kevin.*