


CHECK HOOK ARM PIN BEFORE HOOKUP!


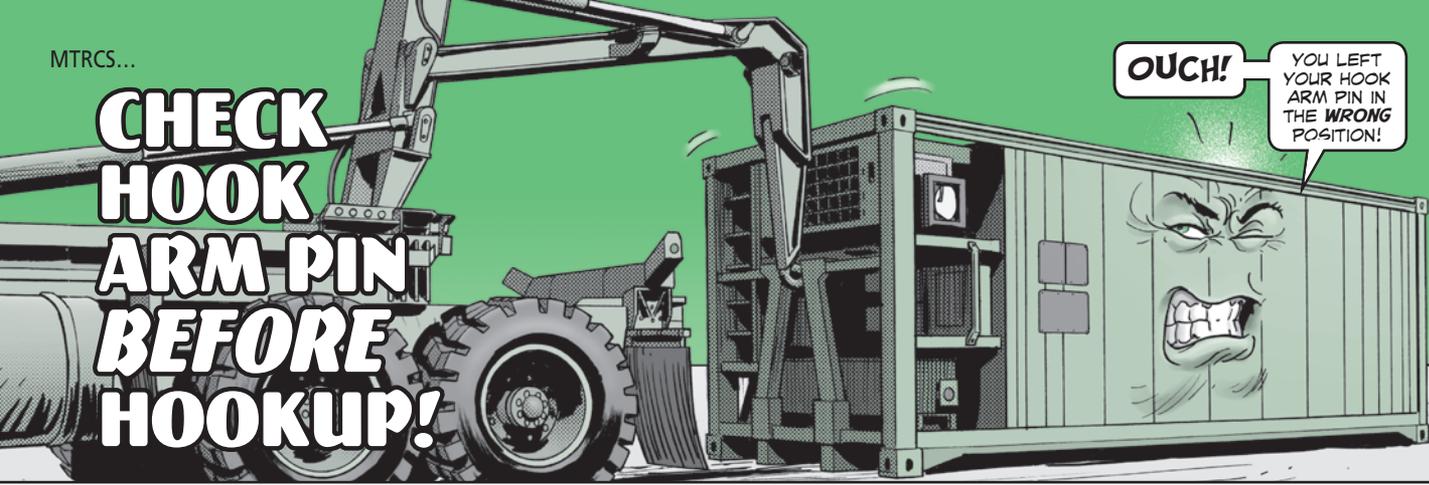



THE MULTI-TEMPERATURE REFRIGERATED CONTAINER SYSTEM (MTRCS) DELIVERS PALLETS OF FOOD TO SOLDIERS IN THE FIELD. THAT'S VERY IMPORTANT WORK, ESPECIALLY IF YOU'RE ONE OF THOSE SOLDIERS.

UNFORTUNATELY, MTRCSs ARE ENDING UP IN THE SHOP BECAUSE SOLDIERS ARE **NOT** CHECKING THE POSITION OF THE HOOK ARM PIN ON THE M1074/A1 PLS OR M1120/A2/A4 HEMTT LHS **BEFORE** HOOKUP.


IF THE HOOK ARM PIN FACES AWAY FROM THE ARM, IT **PUNCTURES** THE CONDENSER AS THE HOOK ARM LIFTS THE MTRCS FOR TRANSPORT.

AND THEN, THERE GOES THE MTRCS REFRIGERATION! IT COSTS \$12K TO REPLACE THE CONDENSER, WHICH IS DIFFICULT TO GET. ONE INSTALLATION LOST **FOUR OUT OF 10** MTRCS CONDENSERS TO THIS SNAFU.

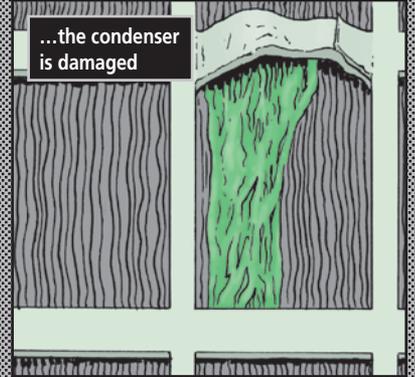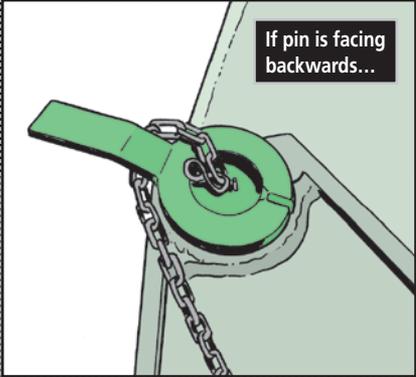

THE DAMAGE IS **EASILY AVOIDABLE.**

BEFORE ATTACHING THE HOOK ARM TO THE MTRCS BALE BAR, MAKE SURE THE HOOK ARM PIN IS POINTING **UP** SO THAT IT'S FLUSH AND ALIGNED WITH THE HOOK ARM.

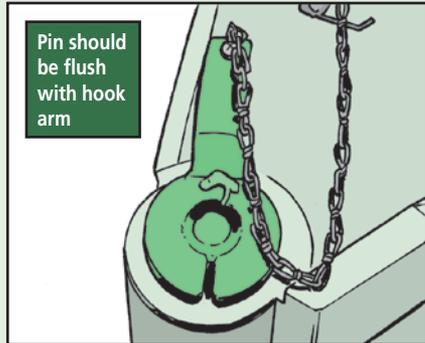

Cleaning Tip

At the end of a mission, the MTRCS must be sanitized before it's turned in. The easiest way to clean out gunk is to take the MTRCS to the wash rack. Tilt it so water drains out and use a high-pressure hose to wash it out. Then scrub it out with bleach and water. When you're finished scrubbing, rinse out the MTRCS with water.

