


Grille Removal Made Easy

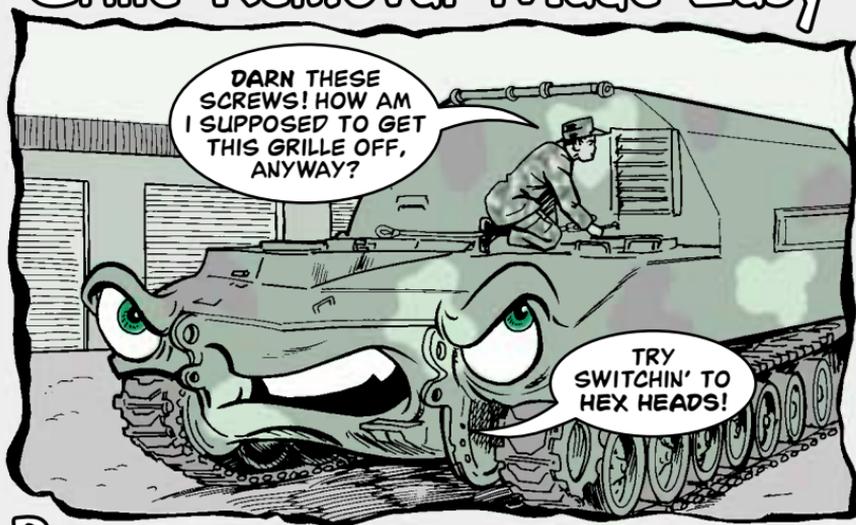

Drivers, the personnel ventilator on your M992A2 ammo carrier has an important job. It pulls in cool, outside air to help keep you comfortable and vents dangerous fumes from the crew compartment—like when the automatic fire extinguisher system (AFES) is activated.

That's why it's important to keep dirt, leaves and other debris cleaned out of the ventilator exhaust. If the exhaust is clogged, there's no airflow and your vehicle is NMC.

At least monthly, remove the grille covering the exhaust and clean out any debris that has collected. You may have some problems with the grille's rear socket head screws, though. Because the screw sits just under the tow cable, you'll have a hard time getting your socket wrench in place to remove them.

Once the grille is finally off, save yourself aggravation next time by replacing the socket head screws with regular hex head screws, NSN 5305-00-719-5219. You can remove them without having to move the tow cable.

Replace socket head screws with hex head screws

