


## Put **P**RESSURE on Rock Guard

**T**he rock guard on your DEUCE's blade tilt cylinder is a haven for mud, small rocks, dirt and sand.

All that crud breaks down the hydraulic hoses inside the rock guard.

When hydraulic hoses start to rot, they spring leaks. Without hydraulic oil, the blade won't retract, elevate or push dirt forward. Then your earthmover's blade is out of commission.

So, after the day's run, use a high-pressure water hose on the tilt cylinder's rock guard. You may have to get your mechanic to remove the rock guard so you can get out all that hard-packed crud.

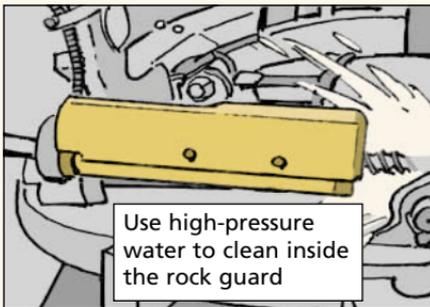

### **4K RTFL Gasket**

A rubber gasket that fits inside the filler cap on the MHE 270/271 forklift's fuel tank is now available. The cap is Item 8 in Fig 24 of TM 10-3930-664-24P. Order the gasket on a DD 1348-6 with CAGE code 97576 and part number 1303-8 from RIC S91.

### **M10A O-ring**

NSN 5330-01-195-8879 gets the O-ring for the hydraulic oil filter on the M10A rough terrain forklift. The NSN shown as Item 9 in Fig 198 of TM 10-3930-643-24P is wrong.

### **6K VRRRT Boot**

A rubber boot is now available separately for the forklift's transmission disconnect cylinder assembly. The assembly is Item 15 in Fig 79 of TM 10-3930-660-24P. Order the boot with NSN 2530-01-314-9265.