

OH-58D...

GOT EJECTOR RACK CORROSION?

RESISTING US IS FUTILE!

YOU WILL BE DEVoured INTO THE CORROSION COLLECTIVE!

YOU'RE GOING DOWN! I'M PROTECTED AGAINST FIENDS LIKE YOU!


Once more into the breach, mechanics, to fight the corrosion war. No matter where corrosion hides out, it can be wiped out.

When you remove the impulse cartridges from your Kiowa's store ejector rack, eyeball the contact areas and the breech for corrosion. If you find hidden corrosion, clean the breech like it says in paragraph 4-70 of TM 9-1090-214-23&P and apply a light coat of lubricating oil, NSN 9150-00-231-2361.

Trapped water in the breech starts the corrosion process, so don't let it build up. If you do, that could stop the cartridges from firing.

A surefire way to seal out water and keep it at bay so weapons continue to fire, is to apply teflon tape, NSN 8030-00-889-3535, to the threads of the cartridge retainers.

Clean breech and apply lubricating oil

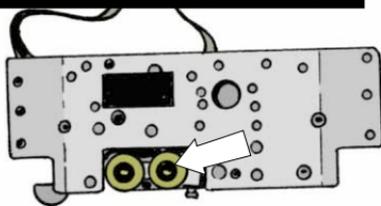

Apply teflon tape to retainer threads to seal out water

