


MK 19 Machine Gun...


Don't Forget Feed Throat

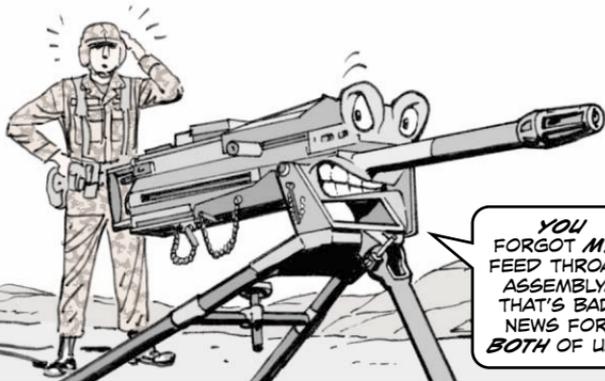

Lots of units who have deployed have shipped out their MK 19 machine guns without the feed throat assemblies. It's easy to forget the feed throat assembly because it's usually stored separately in the arms room from the rest of the gun.

But without the assembly, your MK 19s will have firing stoppages. So when you ship out your MK 19s, make sure you're also shipping out the feed throat assemblies too.

Remember feed throat assembly

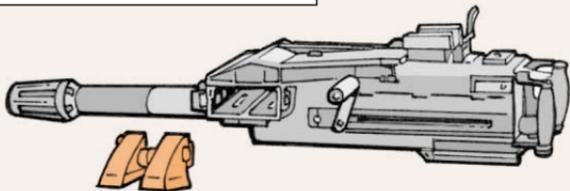

CATCH MK93 CATCH BAG PROBLEMS

If you don't catch MK93 mount catch bag problems on your MK 19 machine gun, they will catch you during firing.

A catch bag that's installed wrong or is not emptied of spent cartridge cases lets cases pile up under the bolt. That makes it difficult for the bolt to move and the firing pin hits the next cartridge before it's fully chambered. The cartridge case ruptures and the projectile doesn't make it out of the barrel. The next round can blow up the barrel.

Make sure the catch bag is installed correctly. Keep an eye on the bag during firing. Empty it when it's almost full.

Make sure catch bag is installed right and emptied

