

100-kW Generator...

**NO EXHAUST COVER, SO...  
CLEAN IT!**




**D**on't look for or try to order an exhaust cover for the 100-kW generator. There isn't one!

The exhaust system needs to be open to vent excess moisture. Otherwise, water will accumulate and get into the engine.

However, when the generator is not running, the exhaust system collects leaves, paper and other debris. That's where you come in. You should check the exhaust regularly and remove any restrictions that inhibit good venting.

Exhaust has clearance around edge that collects debris

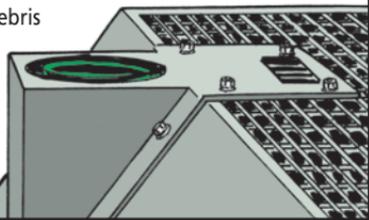

## **BATTERY CABLE LOOSE?**

**B**attery cross-over cables on the 100-kW generator are working loose and then refusing to be tightened.

Say no to their refusal by adding a lock washer, NSN 5310-01-531-6129, between the tightening knob and the cable connector on both ends of the cable.

Remove the tightening knobs that hold the cable to the battery post. Put a lock washer over both posts. Tighten the knobs back in place.

Now the cable should stay tight!

Remove both end connectors and add a lock washer



Replace and tighten end connectors to prevent cable slippage

