


Grip Cap Screw NSN?

Dear Half-Mast,

When I try to order the cap screws for the MK 19 machine gun's control grip assembly (Item 10 in Fig 8 of TM 9-1010-230-23&P), the NSN doesn't show up on FED LOG. What is the correct NSN?

CW2 R. N.

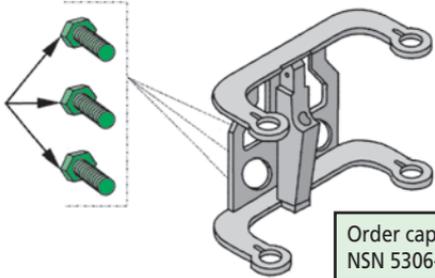

CHIEF R.N., THE *CORRECT* NSN IS 5306-01-564-3587 AND ITS NEW PN IS B1821BHO31FO44L.





THIS WILL BE CORRECTED IN THE NEXT REVISION TO THE TM.

SPRING PIN TOO BIG? *DO THIS*

When you order the spring pin that holds the M240 machine gun's firing pin in the operating rod, you may get one that's too big to fit. (The pin, NSN 5315-01-033-8873, is Item 4 in WP 0037-001 in TM 9-1005-313-23&P.)

If that happens, substitute the spring pin, NSN 5315-01-033-3889, that's Item 5 in WP 0044 00-3. Cut the pin in half so that you have two pins 16mm (0.63 inch) long. File a chamfer around the end of the pin. You now can install the spring pin in the op rod.

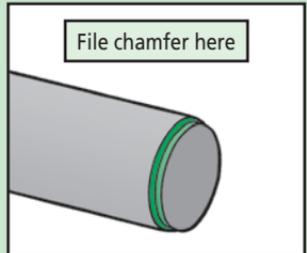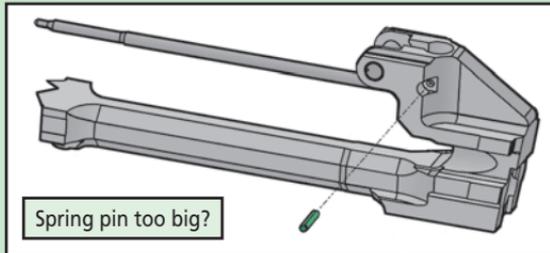

Questions? Contact TACOM-RI's Dennis Bowrey at DSN 793-5943, (309) 782-5943, or email: dennis.bowrey@us.army.mil