


HMMWV...

# DON'T FORGET THE SPACER!

GLAD I HAD  
EAR PROTECTION  
ON THE RANGE!

WHAT ABOUT EAR  
PROTECTION FOR MY  
ALTERNATOR?!

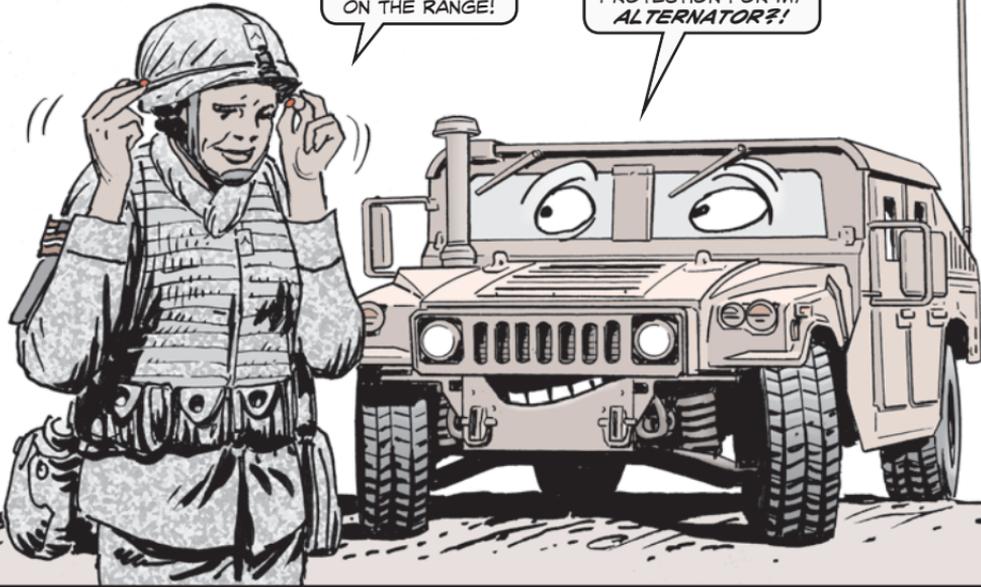

**A** broken ear on the 60-amp, 100-amp or 200-amp alternator on your HMMWV causes downtime and bucks to fix it.

But you'll get a broken ear if you forget to re-install the spacer at the rear alternator brace! Tightening the brace nut without the spacer **in place** puts too much strain on the ear. Then the ear breaks off and the alternator has to go to the rebuild shop.

So remember to reuse the spacer, and don't lose it. Spacer, NSN 5310-01-337-7034, is used with brace, NSN 5340-01-292-8404, on 200-amp alternators.

Spacer, NSN 5310-01-292-5354, is used with brace, NSN 5340-01-293-0125, on 60-amp and 100-amp alternators. For more details, eyeball Pages 4-10 and 4-11 of TM 9-2320-280-20-2.

